

40N 29W H1  
40N 29W I1

**LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich. P.A. 1970

RECORDED

1999 NOV 30 PM 3:31

For corners in

DICKINSON  
(County)  
NORWAY TOWNSHIP

Located In: Corner Code #

1. Public Land Survey T 41 N R 29 W H-13  
T 41 N R 29 W I-13  
T \_\_\_ R \_\_\_  
T \_\_\_ R \_\_\_
2. Property Controlling in Section S \_\_\_ T \_\_\_ R \_\_\_  
S \_\_\_ T \_\_\_ R \_\_\_
3. Miscellaneous Property in Sec. S \_\_\_ T \_\_\_ R \_\_\_  
S \_\_\_ T \_\_\_ R \_\_\_
- SURVEY &  
REMONUMENTATION

MAR 24 2000

REGISTER OF DEEDS  
DICKINSON COUNTY  
RONALD J. BERRY, CLERK

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

SECTION

5. Private Claims \_\_\_\_\_

	A	B	C	D	E	F	G	H	I	J	K	L	M		
1															
2	6			5			4			3			2	1	
3															
4	7						8			9			10	11	12
5															
6	18						17			16			15	14	13
7															
8	19						20			21			22	23	24
9															
10	30						29			28			27	26	25
11															
12	31						32			33			34	35	36
13															

I, JAMES H. MOORE, in a field survey on SEPTEMBER 9 & OCTOBER 13, 19 99 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

**NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:

H-13 SOUTH 1/4 CORNER OF SECTION 34  
FOUND 10" CEDAR PER AUSTIN BURT, D.S. 1846

I-13 CORNER COMMON TO SECTIONS 34-35, T41N-R29W  
CEDAR POST BY AUSTIN BURT, D.S. 1846

USED 10" CEDAR AS CORNER  
NO WITNESSES SET

HEMLOCK 14" N 41° E 30 LINKS  
HEMLOCK 14" N 48° W 22 LINKS

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

H-13 FOUND 1" PIPE WITH 4" MICHIGAN DEPARTMENT OF CONSERVATION BRASS CAP, SET BY DEAN DE LA MATER R.L.S. # 13030 FOUND 2 EXISTING CEDAR B.T.'S IN POOR CONDITION.

I-13 FOUND 1" PIPE WITH 4" MICHIGAN DEPARTMENT OF CONSERVATION BRASS CAP, SET BY DEAN DE LA MATER R.L.S. # 13030.

1954 BEARING TREES  
14" CEDAR S 48° W 25 LINKS  
12" CEDAR S 40° E 29 LINKS

NO WITNESSES SET IN 1954.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

H-13 FOUND ABOVE DESCRIBED MONUMENT IN PLACE.  
NEW WITNESSES.


I-13 FOUND ABOVE DESCRIBED MONUMENT IN PLACE  
NEW WITNESSES.

8" WHITE BIRCH NORTH (M.B.) 32.60' NAIL/TAG  
5" HARD MAPLE S 73° E (M.B.) 49.55' NAIL/TAG  
12" CEDAR S 19° E (M.B.) 45.49' NAIL/TAG  
12" BLACK SPRUCE S 75° W (M.B.) 25.63' NAIL/TAG  
CARSONITE MARKER WEST 0.90'

8" SPRUCE N 08° E (M.B.) 22.60' NAIL/TAG  
3" BALSAM S 13° E (M.B.) 12.50' NAIL/TAG  
6" BALSAM S 30° E (M.B.) 12.40' NAIL/TAG  
2" CHERRY S 55° W (M.B.) 8.15' NAIL/TAG  
CARSONITE MARKER S 65° E 1.15'

Signed by JAMES H. MOORE  
Surveyor's Michigan License No. 28423

Date 11-8-99

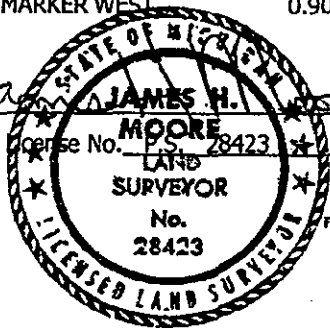

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971

REVISED MAY 14, 1975

REVISED JAN., 1983

REVISED OCT., 1995

ADOPTED BY THE DICKINSON COUNTY SURVEYOR BOARD AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1996 AT A MEETING HELD ON

11-23-99  
Robert J. [Signature]  
COUNTY REPRESENTATIVE

Liber 3 PAGE 11