

M-8/A-8 T41N, R28W
M-12/A-12 T41N, R28W

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

RECORDED

1999 NOV 30 PM 3:31

For corners in

DICKINSON
(County)
NORWAY TOWNSHIP

Located In:

Corner Code #

1. Public Land Survey

T 41 N R 29 W M-8
T 41 N R 29 W M-12

2. Property Controlling in Section

S T R
S T R

3. Miscellaneous Property in Sec.

S T R
S T R

SURVEY & REMONUMENTATION

REGISTER OF DEEDS
DICKINSON COUNTY
NORWAY TOWNSHIP

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat MAR 24 2000

5. Private Claims _____ SECTION

I, JAMES H. MOORE, in a field survey on SEPTEMBER 1 & 2, 19 99 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6			5			4		3		2		1
3													
4	7			8			9		10		11		12
5													
6	18			17			16		15		14		13
7													
8	19			20			21		22		23		24
9													
10	30			29			28		27		26		25
11													
12	31			32			33		34		35		36
13													

A. Description of original monument and accessories and/or subsequent restoration:

M-8 EAST 1/4 CORNER SECTION 24, T41N R29W/ WEST 1/4 CORNER SECTION 19, T41N R28W.
CEDAR POST BY AUSTIN BURT, D.S. 1846
FIR 7" S 70° W 38 LINKS
PINE 18" N 25° E 45 LINKS

M-12 EAST 1/4 CORNER SECTION 36, T41N R29W, WEST 1/4 CORNER SECTION 31, T41N R28W.
CEDAR 6" BY AUSTIN BURT, D.S. 1846
CEDAR 6" S 30° W 12 LINKS

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

M-8 FOUND 1" PIPE WITH 3-3/4" ALUMINUM CAP. SET BY AURTHUR O. ENGER R.L.S. #13581, DATED 11-8-77.

M-12 FOUND 1" PIPE WITH A 4" MICHIGAN DEPARTMENT OF CONSERVATION BRASS CAP, SET BY DEAN DE LA MATER R.L.S. #13030.

1977 BEARING TREES
12" WHITE SPRUCE S 54° E 21.9 FEET
6" RED MAPLE N 1/2° E 20.7 FEET

1954 BEARING TREES
14" CEDAR N 76° W 48 LINKS
16" WHITE PINE N 04° E 64 LINKS

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

M-8 FOUND EXISTING ABOVE DESCRIBED MONUMENT IN PLACE
NEW WITNESSES


M-12 FOUND ABOVE DESCRIBED MONUMENT IN PLACE
NEW WITNESSES

11" SPRUCE S 45° W (M.B.) 49.85' NAIL/TAG
12" SPRUCE N 61° E (M.B.) 32.83' NAIL/TAG
FOUND 9" MAPLE N 02° E (M.B.) 20.85' NAIL/TAG
FOUND 12" SPRUCE S 53° E (M.B.) 22.37' NAIL/TAG
CARSONITE MARKER 1.00'

9" ASH N 02° W (M.B.) 44.20' NAIL/TAG
FOUND 18" WHITE PINE N 08° E (M.B.) 43.38' NAIL/TAG
FOUND 14" CEDAR N 70° W (M.B.) 31.58' NAIL/TAG
14" CEDAR S 08° W (M.B.) 44.15' NAIL/TAG
10" CEDAR S 46° E (M.B.) 46.96' NAIL/TAG
CARSONITE MARKER NORTH 0.30'

Signed by JAMES H. MOORE
Surveyor's Michigan License No. 28423

Date 11-8-99

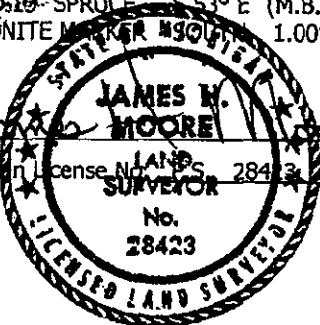

ACCEPTED BY THE DICKINSON COUNTY SURVEY PIER GROUP AS THE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
FORM APPROVED BY MICHIGAN BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
345 OF 1960 AT A MEETING HELD ON 11-23-99
Robert A. P...
COUNTY REPRESENTATIVE

REVISED MAY 14, 1975
REVISED JAN., 1983
REVISED OCT., 1995