

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

Dickinson

(County)

Located In:

Corner Code #

1. Public Land Survey

T41N R 29W J13

T R

T R

T R

2. Property Controlling  
In Section

S T R

S T R

3. Miscellaneous  
Property in Sec.

S T R

S T R

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

Jun 01 1998

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 19\_\_\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:  
(J13) Standard corner South 1/4 corner of Section 35, T41N-R29W. Established by Austin Burt: "West on South Side of Section 35...40.00 Set Qr. Section Post on S. Side of a Ledge of Rock. Spruce 10 N45E 3, Pine 18 N71W 30...41.00 Descend Ledge of Rock 18 ft...80.00...Corner of Sections 34 & 35."

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


(J13) Original post was not recovered. Remonumented the corner on a small ledge protruding from the face of a rock cliff and at record bearing and distance from the remains of the OBT, a solitary W. Pine stump, of record size, no markings visible, found in advanced stages of decay, located on the top of the cliff about 7 ft. above the ledge. An original perpetuated corner at K13 bears S89 deg. 41'E (true) 2642.44' and the descend ledge call at 41.00 chains fits well. An original perpetuated corner at H13 is S89deg. 52'W (true), 5258.30'; J13 being 14' north of a line between K13 and H13. The bottom of the cliff is about 8 ft. below the ledge upon which the corner is found. No trace of the OBT spruce was found. It's location, being only 3 links from the corner, would also be on the ledge. One stump of a small tree was recovered on the ledge but I do not believe that it was the OBT. At the position for the corner, I chiseled a "+" in the rock ledge. Corner placed and witnessed by B.Wheeler and D.Lampela, Baraga District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:  
(J13) Chiseled a "+" in rock ledge.

Blazed and scribed the following:  
8" twin Maple N48W 48.6' "1/4S HBT"  
The following dist. are on the slope:  
8" Sugar S27E 22.4' "1/4S HBT"  
8" twin Sugar S89W 34.2' do  
7" Sugar N64E 32.2' do  
Placed a squared balsam post in a rock pile 2' SE'ly and about 7' below corner.  
Brgs. are magnetic. Distances to notch in lower blaze.

Signed by Stephan J. Szyszkoski  
Surveyor's Michigan License No. 33986

Date 3/30/99

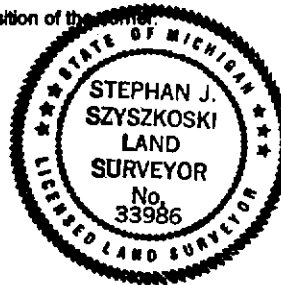

For the Michigan Department of Natural Resources - Forest Management Division