

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

RECORDED

1998 DEC 14 PM 12:25

For corners in

<u>Dickinson</u>	Located In:	Corner Code #
(County)		
Norway Twp.		
1. Public Land Survey	T <u>41N</u> R <u>30W</u>	<u>K-7</u>
	T ___ R ___	<u>K-8</u>
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____

REGISTER OF DEEDS
DICKINSON COUNTY
RON FORD, CLERK

SURVEY &
REMONUMENTATION

MAR 17 1999

SECTION _____ Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Robert F. Perkins, in a field survey on Sept. 25, 1998 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

K-7 Corner Common to Sections 13-14-23-24
Post by John Burt, D.S. 1849
Original Bearing Trees
Hemlock 12" S30°W 24 Lk.
Y. Birch 12" S74°E 23 Lk.

K-8 ¼ Corner Common to Sections 23/24
Post by John Burt, D.S. 1849
Hemlock 8" N73°E 24 Lk.
Lynn 10" S33°W 20 Lk.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

K-7 No Evidence of Original Corner or its Accessories Found.
Found 1" Pipe Monument with 4" D.N.R.
Cap set by B. Buckler, RLS in 1962 (Old Report #731)
1962 Witnesses:
W.Pine 18" N13°W 45 Lk. (Found)
W.Pine 22" N40°E 81½ Lk. (Found)

K-8 Found 1" Iron Pipe with 4" D.N.R. Cap Set by D.C. DeLaMater, RLS in 1953 from Stumps of 2 G.L.O. BT's (Old Report #124)
Found Stump of 1953 Bearing Tree.
"Aspen 12" S32°E 28 Lk.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K-7 Accepted Marker described in "B" above.
New Witnesses:
Maple 9" West 9.64' Nail/Tag
Maple 10" S33°E(M.B.) 9.74' Nail/Tag
* W.Pine 24" N13°W(M.B.) 30.05' Nail/Tag
*W.Pine 28" N40°E(M.B.) 54.53' Nail/Tag
Placed Carsonite Marker 1.1' N.E.

K-8 Accepted Marker described in "B" above.
New Witnesses:
Aspen 3" N01°E(M.B.) 20.70' Nail/Tag
Aspen 3" N49°E(M.B.) 31.37' Nail/Tag
Balm 3" S37°E(M.B.) 1.82' Nail/Tag
Balm 6" S64°W(M.B.) 15.15' Nail/Tag
Placed Carsonite Marker 1.0' South.

* 1962 Bearing Tree.


Signed by Robert F. Perkins Date Oct. 28, 1998

Surveyor's Michigan License No. 12027

ACCEPTED BY THE DICKINSON COUNTY SURVEY PEER GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 74 OF 1990 AT A MEETING HELD ON

12-7-98

Robert F. Perkins
COUNTY REPRESENTATIVE

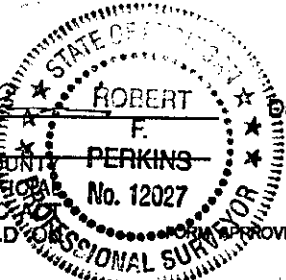

Libor 2

Page 418