

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

(DICKINSON COUNTY)

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 42 N. R. 29 XX W.	F-7
2. PROPERTY CONTROLLING IN SECTION	16, T. 42 N. R. 29 XX W.	#16
3. MISCELLANEOUS PROPERTY IN SECTION	, T. N. R. E. S. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on see below, 19____, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corner F7 (1/4 corner between Sections 16 & 21, T42N, R29W):

- Y. Birch post (Not found. No subsequent monuments found.)
- Y. Birch 8 N23W 25 (" " " " accessories ")
- W. Pine 30 S35E 14 (" " " " " ")

Corner 16 (East 1/16 corner between Sections 16 & 21, T42N, R29W):

Not established in original survey and by approximation only, subsequently.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

Corner F7: Re-established 4/19/77 on line between Sec. Cor. 40.127 ch. to E and to W. Position checks with original field notes as to a ridge top, course SW, 6 chains W and is on E side of a hill, although there is some question as to what was meant by this call in the original notes.

Corner 16: Established 4/20/77 on line between Sec. Cor. 20.064 ch. E and 1/4 Cor. 20.064 ch. W. Found a 3" x 3" x 5' squared cedar post N26 1/2° E 47.9 ft. for an approx. cor., and as there were no corners existing on either side of it when found, it can not be regarded as anything but that.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner F7: 1" I.D. x 36" iron pipe with 3 3/4" aluminum cap.
 Sugar Maple 7 S69°W (mag.) 14.7 ft. "1/4S, NBT"
 Sugar Maple 5 N51°E (mag.) 13.7 ft. "1/4S, NBT"
 Declination is 2°00' West

Corner 16: 1" I.D. x 36" iron pipe with 3 3/4" aluminum cap.
 White Spruce 12 N 3°W (mag.) 20.2 ft. "1/16S, BT"
 White Spruce 4 S37°E (mag.) 14.2 ft. "1/16S, BT"
 Declination is 1°00' West

SIGNED BY _____ DATE _____


SURVEYOR'S MICHIGAN REGISTRATION NO. _____ (SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY Arthur O. Enger DATE March 31, 1978

CHIEF OF SURVEY PARTY
 MICHIGAN REGISTERED LAND SURVEYOR
Arthur O. Enger
 Michigan Department of Natural Resources

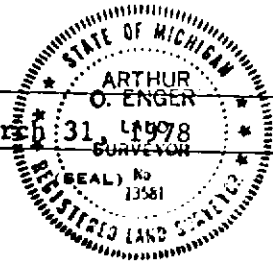

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581