

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

DICKINSON COUNTY

| FOR CORNERS OF--: | LOCATED IN--: | CORNER CODE NUMBER |
|--|---|--------------------|
| 1. PUBLIC LAND SURVEY _____ | T. <u>42</u> N. <u>2</u> , R. <u>29</u> E. <u>3</u> W. _____ | F-3 & G-3 |
| 2. PROPERTY CONTROLLING IN SECTION _____ | T. _____ N. _____ S. _____ R. _____ E. _____ W. _____ | _____ |
| 3. MISCELLANEOUS PROPERTY IN SECTION _____ | T. _____ N. _____ S. _____ R. _____ E. _____ W. _____ | _____ |
| 4. LOT NO. _____, RECORDED PLAT _____ | _____ | |
| 5. PRIVATE CLAIMS _____ | _____ | |

REGISTER OF DEEDS STAMP AND
FILING NUMBER

I, Arthur O. Enger, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on see below, 19____, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corner F3 (1/4 corner between Sections 4 & 9, T42N, R29W);
 Cedar post (Not found. No subsequent monuments found.)
 Hemlock 14 S63E 27 (" " " " accessories ")
 Hemlock 12 N13W 19 (" " " " " ")

Corner G3 (Section Corner 3, 4, 9, & 10, T42N, R29W):
 Sugar post
 Sugar 26 N47E 9
 Sugar 20 S31W 24

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

Corner F3: Re-established 5/24/77 on line between Sec. Cor. 40.522 ch. to E and to W. Corner falls about 1.10 ch. W of top of hill course SW, as per original field notes.
Corner G3: Re-established 6/23/76 proportionately on line between original 1/4 cor. 40.025 ch. S and a point 90 lks. E of an original corner on N twp. bdy., which was the record falling of the original line on that corner. Corner thus set lies N0°14.0'E 40.025 ch. from the 1/4 cor. to S and S0°24.3'E 80.862 ch. from the sec. cor. to N. At exactly 10.25 ch. N of the subject corner on the computed true sec. line, found a 16" cedar stump (no marks) which corresponds with an original Cedar 16 line tree reported in the original field notes at that position. Also identified an original off-line blazed tree (dead cedar stub) south of corner, indicating the sec. line was East of it, which is confirmed by the corner placement reported here.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner F3: 1" I. D. x 36" iron pipe with 3 3/4" aluminum cap.
 No convenient witness trees or other objects. Corner falls in area of recently clear-cut forest.
 Declination 2°30' East.

Corner G3: 1" I.D. x 36" iron pipe with 3 3/4" aluminum cap.
 Sugar Maple 6 S33°W (mag.) 27.2 ft. "S9, NBT"
 Sugar Maple 6 S21°E (mag.) 24.5 ft. "S10, NBT"

SIGNED BY _____ DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

(SEAL)


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY Arthur O. Enger DATE October 28, 1977

CHIEF OF SURVEY PARTY
 MICHIGAN REGISTERED LAND SURVEYOR

Arthur O. Enger
 Michigan Department of Natural Resources

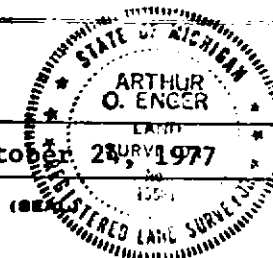

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581