

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in  
Dickinson

County	Located In:	Corner Code #
1. Public Land Survey	T 44N R 28W	L7
	T 44N R 28W	L8
	T 44N R 28W	L9
2. Property Controlling in Section	T ___ R ___	___
	S ___ T ___ R ___	___
	S ___ T ___ R ___	___
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	___
	S ___ T ___ R ___	___

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

L9 January 21, 1993  
L8 February 09, 1993

I, Stephan J. Szyszkoski, in a field survey on 17 January 21, 1993, 19 \_\_\_\_\_ do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
2													
3													
4													
5													
6													
7													
8													
9													
10													
11													
12													
13													

A. Description of original monument and accessories and/or subsequent restoration:

- (L7) Quarter corner common to Sections 13 and 24. Cedar post placed for corner in original survey, 1850. BTs: Cedar 8 S70W 10, Spruce 10 N66E 18. Found no subsequent record.
- (L8) Center of Section 24. Corner not established in original survey. Found no subsequent record.
- (L9) Quarter corner common to Sections 24 and 25. Cedar post placed for corner in original survey, 1850. BTs: Spruce 6 S70W 50, Cedar 8 N70E 25. Found no subsequent record.


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- (L7) Original post and accessories not recovered. Found no evidence on the ground of the original corner location. Reestablished the corner by single proportionate measurement to the original record between section corners 2643.75' east and west, both of record.
- (L8) Found no evidence of prior monumentation or evidence of use at corner location. Established corner at the intersection of straight lines connecting opposite 1/4 corners, all as recorded this date.
- (L9) Original post and accessories not recovered. Found no evidence of the original corner location on the ground. Found a single cedar stump in corner area, but no markings of any kind visible. Reestablished the corner by single proportionate measurement to the original record between section corners 2649.14' west and east, the easterly section corner location being determined from the witness corner recorded in 1985.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- |   |  |  |
|---|--|--|
| (L7) Set 1"x32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet. Blazed and scribed the following:<br>12" Cedar N19E 12.0' (1/4S HBT)<br>7" Cedar S80E 9.0' (1/4S HBT)<br>10" Cedar S07W 16.6' (1/4S HBT)<br>10" Cedar N55W 2.0' (1/4S HBT)<br>E-W cut line is 15.0' south. | (L8) Set a 1"x32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet. Blazed and scribed the following:<br>4" Balsam N63E 17.3' (1/4S BT)<br>9" Spruce S53E 49.6' (1/4S BT)<br>7" Spruce S40W 28.9' (1/4S BT)<br>9" Balsam N10W 45.3' (1/4S BT)<br>Cut line runs N-S-E-W from corner. | (L9) Set 1"x32" iron pipe capped with a 4" cast aluminum MDNR tablet. Blazed and scribed the following:<br>6" Spruce S78E 24.9' (1/4S HBT)<br>3" Balsam N70E 20.7' (1/4S HBT)<br>7" Aspen N25E 43.1' (1/4S HBT)<br>5" squared cedar post West 1.0' scribed "24/25 1/4". Cut line to west is 17' North. |
|---|--|--|

Signed by Stephan J. Szyszkoski  
Surveyor's Michigan License No. 33986

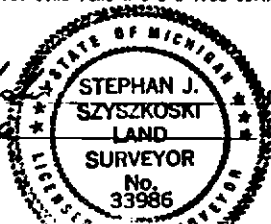

Date 2-18-93