

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER	
1. PUBLIC LAND SURVEY_____	T. <u>44</u> N. <u>30</u> R. <u>29</u> ^{30X} W.	D3 & E3	REGISTER OF DEEDS STAMP AND FILING NUMBER
2. PROPERTY CONTROLL- ING IN SECTION_____	T. _____ N. _____ E. _____ S., R. _____ W. _____		
3. MISCELLANEOUS PROPERTY IN SECTION_____	T. _____ N. _____ E. _____ S., R. _____ W. _____		
4. LOT NO. _____, RECORDED PLAT _____			
5. PRIVATE CLAIMS _____			

I, Arthur O. Enger, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on May 22, 1975, 19____, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corner D3 (1/4 corner between Sections 5 & 8, T44N, R29W):
 Tamarack Post (Found point of post. No later monuments.)
 Tamarack 8 S70E 23 (Found.) No subsequent accessories found.
 Tamarack 8 N50W 22 (Not found.) " " " "

Corner E3 (Section Corner 4, 5, 8, & 9, T44N, R29W):
 Cedar Post (Not found. No subsequent monuments found.)
 W. Pine 30 S69W 61 (Found.) No subsequent accessories found.
 W. Pine 30 N15E 19 (Found.) " " " "

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

Corner D3: Re-monumented at site of original post, point of which was found in swamp peat at record bearing and distance from original BT, indicated above, identified by plain scribe marks on slabs of the old witness and description blazes. Corner bears N89°34'E 40.712 ch. from original Sec. Cor. 5, 6, 7, & 8 and N89°37'W 40.259 ch. from original Sec. Cor. 4, 5, 8, & 9.

Corner E3: Re-monumented by reference to stump of original BT to NE and plain stump bottom, with roots, of BT to SW. No marks, but agree with original record as to species and size and relative positions from each other. Corner lies S89°37'E 40.259 ch. from original cor. to W, S89°54'W 159.337 ch. from original corner to E, N0°59'W 7.065 ch. from original line tree to S, and S0°50'E 80.456 ch. from original corner to N.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner D3: 1" I.D. x 36" iron pipe with 3½" aluminum cap.
 Black Spruce 8 S54°E (mag.) 37.5 ft. "1/4S, NBT"
 Tamarack 5 N81°E (mag.) 40.5 ft. "1/4S, NBT"

Corner E3: 1" I.D. x 36" iron pipe with 3½" aluminum cap.
 White Pine 18 S84°W (mag.) 25.1 ft. "S8, NBT"
 Tamarack 9 N38°E (mag.) 32.4 ft. "S4, NBT"

SIGNED BY _____ DATE _____


SURVEYOR'S MICHIGAN REGISTRATION NO. _____ (SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY Arthur O. Enger DATE January 26, 1976

CHIEF OF SURVEY PARTY
 MICHIGAN REGISTERED LAND SURVEYOR
 Arthur O. Enger

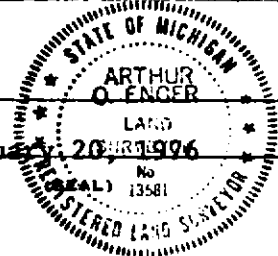

Michigan Department of Natural Resources

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581