

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>44</u> ^{N.} / _X R. <u>29</u> ^{E.} / _{W.}	C2 & C3
2. PROPERTY CONTROLLING IN SECTION _____	, T. _____ ^{N.} / _{S.} R. _____ ^{E.} / _{W.}	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____ ^{N.} / _{S.} R. _____ ^{E.} / _{W.}	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on May 7, 1975, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corner C2 (1/4 corner between Sections 5 & 6, T44N, R29W):

Cedar Post (Not found. No subsequent monuments found.)
 Y. Pine 26 S85E 23 (Not found. No subsequent accessories found.)
 Y. Pine 26 N25W 15 (Probably found. No subsequent accessories found.)

Corner C3 (Section Corner 5, 6, 7, & 8, T44N, R29W):

Maple Post (Not found. No subsequent monuments found.)
 W. Pine 18 S40W 52 (Probably found. No subsequent accessories found.)
 W. Pine 20 N21E 15 (" " " " " ")

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

Corner C2: Replaced corner at record bearing and distance from BT stump noted above. No marks, but agrees with record as to species and size. Corner falls S0°07'E 39.962 ch. from original corner on township line N and N0°28'W 40.170 ch. from probable original sec. cor. S, the record distances being 39.92 ch. and 40.00 ch., respectively. Found stump hole corresponding to a W. Pine 22 line tree N0°14'W 9.850 ch., the record distance being 9.86 ch.

Corner C3: Replaced corner at record bearing and distance from BT stumps noted above. No marks, but agree in species, size, and relative position from each other. Distances N, S, E, and W to original corners are 40.170 ch., 79.904 ch., 40.712 ch., and 39.948 ch., respectively.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner C2: 1" I.D. x 36" iron pipe with 3½" aluminum cap.
 Red Maple 6 N21°W (mag.) 4.3 ft. "1/4S, NBT"
 Red Maple 6 S10°E (mag.) 25.9 ft. "1/4S, NBT"
Corner C3: 1" I.D. x 36" iron pipe with 3½" aluminum cap.
 White Pine 24 N83°E (mag.) 120.8 ft. "S5, NBT"
 White Pine 18 S31°E (mag.) 122.2 ft. "S8, NBT"

SIGNED BY _____ DATE _____


SURVEYOR'S MICHIGAN REGISTRATION NO. _____ (SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY Arthur O. Enger DATE January 26, 1976

CHIEF OF SURVEY PARTY
 MICHIGAN REGISTERED LAND SURVEYOR
 Arthur O. Enger

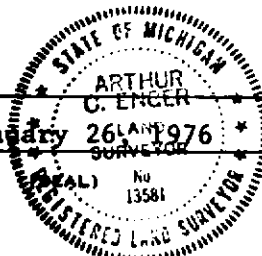

Michigan Department of Natural Resources

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581