FILED
copy

EATON COUNTY REMONUMENTATION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

95 DEC 26 PM 2:29

For corners in
EATON
(County)

LINDA M. TWITCHELL
REGISTER OF DEEDS
EATON COUNTY, MICH.

h. 3 pg 659

Register of Deeds Stamp & File Number

	Located in:	Corner Code #:
1. Public Land Survey	T 3N R 6W	B-2
CENTER OF SECTION	T ___ R ___	
6 VERMONTVILLE TOWNSHIP	T ___ R ___	
	T ___ R ___	
2. Property Controlling	S ___ T ___ R ___	
in Section	S ___ T ___ R ___	
3. Miscellaneous	S ___ T ___ R ___	
Property in Sec.	S ___ T ___ R ___	

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

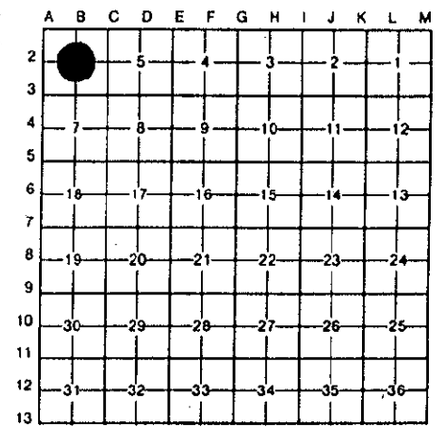

I, **BRIAN REYNOLDS**, in a field survey on **2 JULY**, 19 **93**, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1 CORNER NOT SET BY THE GENERAL LAND OFFICE.

2 COUNTY SURVEYOR RECORDS: OSCAR CHURCH, AUGUST 15, 1878 (V. 2, P.66-67) "STAKE"

3 NO OTHER RECORDED HISTORICAL INFORMATION AVAILABLE FOR THIS CORNER

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FOUND INTERSECTION OF FENCES, EXCAVATED, AND FOUND NOTHING. AFTER COMPLETE TRAVERSE OF SECTION 6, TYING IN OCCUPATION ACCEPTED FENCE CORNER AS BEST EVIDENCE OF CORNER POSITION.

SET STANDARD EATON COUNTY REMONUMENTATION MONUMENT AT FENCE CORNER.

TO	A-2	S89°49'19"W	3118.14'
TO	B-1	N0°22'36"E	2752.98'
TO	B-3	S0°08'41"W	2632.60'
TO	C-2	N89°36'58"E	2641.28'

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

SET STANDARD EATON COUNTY REMONUMENTATION MONUMENT (WITH PLASTIC CAP)
SET 20d NAIL WITH PLASTIC TAG IN THE NORTHWEST SIDE OF A 6" IRONWOOD N39°E 25.74'
SET 20d NAIL WITH PLASTIC TAG IN THE EAST SIDE OF A 20" MAPLE N82°E 29.95'
SET 20d NAIL WITH PLASTIC TAG IN THE SOUTH SIDE OF A 6" CHERRY S64°E 39.07'
SET 20d NAIL WITH PLASTIC TAG IN THE NORTH SIDE OF A 4" BASSWOOD S53°E 33.50'
SET 20d NAIL WITH PLASTIC TAG IN THE NORTHWEST SIDE OF A 16" BEECH S72°W 28.84'
FENCE POST NORTHWEST 0.80'
FENCE CORNER POST SOUTH 0.30'

STATE OF MICHIGAN
BRIAN REYNOLDS
LAND SURVEYOR
NO. 31602
LICENSED LAND SURVEYOR

Signed by _____ Date 12/21/95

Surveyor's Michigan License No. 31602

~~P.A. 345 EATON COUNTY~~

PEER APPROVED 9/28/95

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983