
## LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. PA 1970

	Filling 1104
<b>n:</b>	Located In Corner Code #
d Survey Controlling neous in Section	T 35N R 4W A-5 T 35N R 4W B-5 S T R S T R S T R S T R S T R S T R S T R S T R S T R S T R S T R S T R S T R S T R S T R R R S T R R R S T R R R S T R R R S T R R R S T R R R R
	Recorded Plat:
-	

Register of Deeds Stamp & File Number

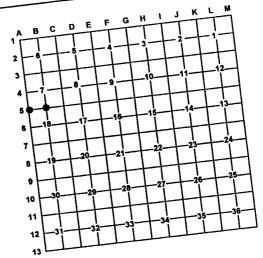

Kijskila, in a field survey on May 6, 1998 do hereby state that under ents of PA 74, Michigan PA of 1970, the corner points mentioned in lines 1 conve were in conformance with regulations and rules therefore as required in the manual of survey instructions of the United States Department of the manual of survey instructions of the Court of Law and/or that the Bureau of Land Management or by a decree of a Court of Law and/or that the solutions mentioned in lines 3, 4 and 5 above were in conformance with the rules Bureau of Land Management or by a decree of a Court of Law and/or that the points mentioned in lines 3, 4 and 5 above were in conformance with the rules points mentioned in lines 3, 4 and 5 above were in conformance with the rules points mentioned in lines 3, 4 and 5 above were in conformance of a Court of Law; Michigan Board of Land Surveyors or by a Decree of a Court of Law; Shed, re-established, monumented, recovered, found as expressed below:

: Not more than 2 corners, all in the same town and range, may corded on this certificate.

Description of original monument and accessories and/or subsequent restoration:

- G.L.O. John Mullett D.S. 1840 20 links Wit: Hemlock 8" N49°W S54°W
  - 20 links Beech 6"
  - R. Oelke P.S. #33983, Liber 3, Page 32 Found "T" iron for corner
    - 38.80 S75°E Wit: Maple 12" 102.64 S60°W 88.74 5 Ash N40°E
- B-5 G.L.O. John Mullett D.S. 1840 Set quarter section post S71°W 34
  - Wit: Beech 10 S28°W 95 Beech 10
  - R. Oelke P.S.#33983, Liber 3, page 32 Found 1-1/2" iron pipe at road intersection S25°E Wit: P. Pole 65.61 S40°E P. Pole 43.55 40" Maple S20°W
- B. Description of corner evidence found and/or method applies in restoring or re-establishing corner: B-5 Found and accepted a "T" iron fitting R. Oelke P.S.
- A-5 Found and accepted a "T" iron as witnessed by R. Oelke P.S.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

A-5 "T" iron

51.47 N26°W Wit: 6" Maple 91.38 10" White pine S73°W 50.21 9" Hemlock 35.14 N33°W N43°E 88.74' \*16" Poplar Centerline of blacktop road South 1.5' \* Power Pole

N76°E 94.32' S55°E 65.62' S24°E 64.35' \*Power Pole Fence corner post \$53°W 45.22' Power Pole Centerline of E-W road North 2'

\*Old witnesses by R. Oelke P.S.

\*Old witnesses by R. Oelke P.S.

Signed by:

33981 Surveyor's Michigan License No.:

Date:

9-29-99