

APR 27 1995

1994 REMONUMENTATION PROGRAM

COMMISSION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>GENESEE</u> (County)	Located in:	Corner Code #/
	MUNDY	
1. Public Land Survey	T <u>6N</u> R <u>6E</u>	<u>D-3</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling In Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

RECORDED
FEB 16 7 37 AM '95
77915
Register of Deeds Stamp & File Number

I, RICHARD H. KRAFT, P.S. in a field survey on OCTOBER 25, 19 94 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules theretofore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

A	B	C	D	E	F	G	H	I	J	K	L	A
2	6	5	4	3	2	1						
3		•										
4	7	8	9	10	11	12						
5												
6	16	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												


NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

- A. Description of original monument and accessories and/or subsequent restoration:
- 1823 GLO; HARVEY PARKE, D.S. - SET POST - NO ACCESSORIES
 - 1926 GCRC - FOUND IRON, SET 6 ACCESSORIES
 - 1965 GCRC - SET IRON IN MONUMENT BOX, SET 4 ACCESSORIES
 - 1988 CARL CARLSON, R.L.S., FOUND 1" PIPE IN MONUMENT BOX, RECORDED 4 ACCESSORIES
L 2330, PAGE 919
 - 1988 SHELDON BROWN, R.L.S., FOUND 3/4" PIPE IN MONUMENT BOX, RECORDED 4 ACCESSORIES
L 2548, PAGE 788

3. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
- 1994 RICHARD H. KRAFT, R.L.S. - FOUND 3/4" PIPE IN MONUMENT BOX
 - 1994 SHELDON BROWN - REC. 3/4" PIPE IN MONUMENT BOX
N4°E, CHC TAG IN POWER POLE 125.01' (MEASURED 125.01')
SOUTH, FACE R/W MARKER 59.69' (MEASURED 59.72')
S75°W, CHC TAG IN POWER POLE 246.63' (MEASURED 246.63')

RATIFIED BY GENESEE COUNTY PEER GROUP DECEMBER 21, 1994. Ratified by Peer Group in accordance with P.A. 345, 1990
Co. Rep. Carl D. Carlson
Date 12-21-94

3. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
- D-3 SET STANDARD GENESEE COUNTY MONUMENT IN MONUMENT BOX
N4°E FOUND NAIL & TAG (CARLSON) IN POWER POLE 125.01'
SOUTH FACE OF R/W MARKER 59.72'
S75°W FOUND NAIL & TAG (CARLSON) IN POWER POLE 246.13'
S25°E SET P.K. & TAG IN FENCE (27' E OF FENCE CORNER) 65.60'

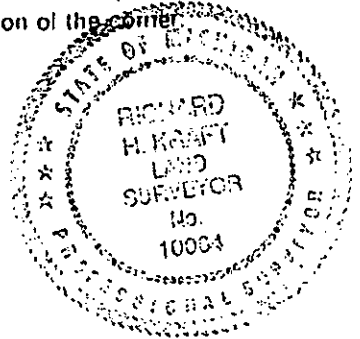

Signed by Richard H. Kraft Date DECEMBER 31, 1994
Surveyor's Michigan License No. 10064