

SURVEY & REMONUMENTATION

MAY 31 2000

SECTION

1996 Remonumentation Program
LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970

MASTER LIBER 3434 PAGE 291

For corners in

_____ Genesee _____	Located In:	Corner Code #
(county)		
1. Public Land Survey	T 8N R 8E	B-7
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

RECORDED
 REGISTERED
 DEC 23 2 07 PM '96
 GENESSEE COUNTY REGISTER OF DEEDS
 82428
 Register of Deeds Stamp & File Number
9.00 filed per [unclear]

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

I, James E. Kovas, in a field survey on November 12, 1996, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7	●											
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- B-7 1821 - G.L.O. Set 1/4 Post WIT: South 17 Lks. Beech; N80°W 15 Lks. S.Maple.
 1985 - Flint Surveying & Eng., Survey, 5/8" Iron Rod in Mon. Box. WIT: North 51.61' 15" Elm; N5°E 35' Nail in P.Pole; S50°E 47.71' Nail 36" Oak; S25°W 30.46' Nail 30" Oak.
 1985 - Flint Surveying & Eng., Survey, 5/8" Iron Rod in Mon. Box, WIT: North 51.61' 15" Elm; S50°E 47.71' Nail 36" Oak; S25°W 30.46' Nail 30" Oak.
 1991 - Rowe Eng., Survey (L. 2428, P. 441), No Monument Descr., no accessories.
 1991 - Flint Surveying & Eng., Survey, 5/8" Iron Rod in Mon. Box WIT: North 51.61' 15" Elm; N5°E 35' Nail in P.Pole; S50°E 47.71' Nail 36" Oak; S25°W 30.46' Nail 30" Oak.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- B-7 Found 5/8" Iron Rod in Monument Box
 WIT: N5°E 35.13' Fnd Nail in P.Pole
 S50°E 47.7' Fnd Oak Stump


Ratified by Peer Group in accordance with P.A. 345, 1990

Co. Rep. [Signature]
 Date 11-6-96

The monument found was ratified by the Peer Review Committee on November 6, 1996, as the accepted corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- B-7 Set 2" X 30" Iron Pipe with Brass Genesee County Remonumentation Cap in Existing Monument Box, at location of 5/8" Iron Rod.
 WIT: N5°E 35.13' Fnd Nail in P.Pole
 S50°E 47.68' Set 60d Nail/ Genesee Co. Tag in SW Face 36" Stump
 S60°E 69.04' Set 60d Nail/ Genesee Co. Tag in NE Face 24" Maple
 S75°W 99.70' Set 60d Nail/ Genesee Co. Tag N. Face 12" Elm
 N65°W 105.70' Set 60d Nail/ Genesee Co. Tag S.Face U.Pole
 North 51.78' Set 60d Nail/ Genesee Co. Tag E.Face 12" Elm
 S30°W 31.22" Set 60d Nail/ Genesee Co. Tag W.Face 24" Stump

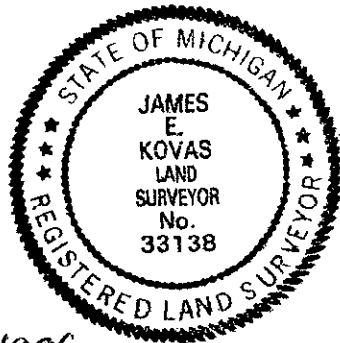

Signed by James E. Kovas

Date Dec. 18, 1996

Surveyor's Michigan License No. 33138

102