

**SURVEY &
REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE**

SEP 07 1999

Filing Requirement of Act 74, Mich. P.A. 1970
Gladwin County Remonumentation

LIBER 001 PAGE 266

For Corners in SECTION
GLADWIN

(County)	Located In:	Corner Code#:
1. Public Land Survey	T. <u>17N</u> R. <u>2W</u>	<u>A-5</u>
	T. _____ R. _____	_____
	T. _____ R. _____	_____
2. Public Controlling in Section	S. _____ T. _____ R. _____	_____
	S. _____ T. _____ R. _____	_____
3. Miscellaneous Property in Section	S. _____ T. _____ R. _____	_____
	S. _____ T. _____ R. _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

STATE OF MICHIGAN
GLADWIN COUNTY
Filed-Remon

16 AUG 1999 2:35:14 PM

DONNIE K. HOUSE
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

I, Mark R. Robison, in a field survey on March 31, 1999, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:

1831 Robert Clark Jr.
Set Post Sec's 12 & 13 in swamp
Wit-(1)Hemlock 20 N54W 45
(2)B. Ash 16 S27W 20

1980 Lapham LCRC#240
Found Iron
Wit-same as (3), (4) & (5)

1996 Robison LCRC#161-96
Set Clare County Remon in Mon Box
Approved Land Corner PA 345 of
1990

1972 Lapham working dwg

1987 Lapham survey
Found Iron
Wit-(6)N45W Stud Pole 55.75
(7)S45W P.P. 90.70
(8)South Stud Pole 31.25

1979 Lapham survey
Found C.I.
Wit-(3)S25E, 43.20' - 14" Maple
(4)S05W, 31.28' - Tele. Pole
(5)N30W, 55.75' - Tele. Pole

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

Found Clare County Remonumentation, monument in monument box, marked P.S.#27458, in intersection of East-West-North roads. Corner agrees with witnesses as recorded on LCRC#161-96, Clare County, Michigan Public Records.

**APPROVED LAND CORNER
P.A. 345 of 1990
Gladwin County**


Co. Rep. [Signature]
Date 8/13/99

See dossier for detailed report.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

A-5: Accepted found 5/8" x 36" rorod with 3" Clare County Remonumentation cap marked P.S.#27458 in Monument Box.

Witnesses:
S05°W Tele. Pole, nail & tag, 31.28'
N28°W Tele. Pole, nail & tag, 55.75'
N60°E Cor. Post, nail & tag, 47.30'
N70°E 8" Pine, nail & tag, 76.75' (NBT)
N43°W 12" Maple, nail & tag, 127.50' (NBT)

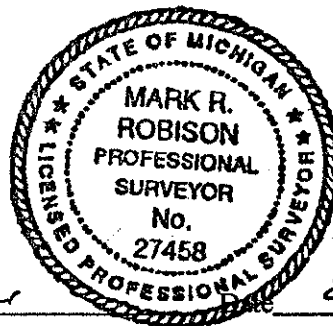

Signed by Mark R. Robison
Surveyor's Michigan License No. 27458

8-10-99