

FEB 18 1994


LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

JUL 25 93 AM

COMMISSION

For corners in

Form with fields for Gladwin (County), Located In: (Town, Range, Section), Corner Code (#), and numbered items 1-5 for survey details.

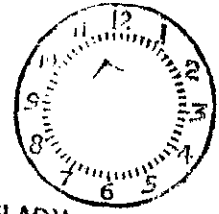

Signature of the Register of Deeds.

Register of Deeds Stamp & File Number

Craig W. McVean, in a field survey on October 29, 1993, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

Grid table with columns A-L and rows 2-13, containing numerical data points for survey locations.

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

E-7 Intersect principle meridian 3.36 Ch. S of corner of Sec. 12&13, T18N, R1W, J. Mullet, 1847. Set post at intersection for Sec. 16&21, T18N, R1E. B. Ash 8" N 62° E 16 Lks. B. Ash 8" S 63° E 22 Lks.

E-8 Not set in original survey. M.D.O.T. witness card - 1961 - Gilbert - 3/4" rod in mon. box. M.D.O.T. witness card - 1975 - Bennett - 3/8" Iron in mon. box. L.C.R.C. - P. 109 - 1975 - Hooth. Recorded Survey, L. 1, P. 904 - 1978.

M.D.O.T. witness card - 1961, Gilbert - 3/4" rod in mon. box. M.D.O.T. witness card - 1975, Bennett rod in mon. box. L.C.R.C. - P. 128, 1975 - Hooth (M.D.O.T.) Dundas - witness - prior to 1958.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

E-7 Closing corner common to Sec. 16&21, T18N, R1E. Found 3/4" Iron rod in mon. box per L.C.R.C. and M.D.O.T. witness cards. Fits GLO closing to M5-T18N-R1W. Monument accepted as the best available evidence of the position of the original corner. Accepted by Gladwin County Peer Review Group on 12-10-93.

E-8 1/4 corner common to Sec. 21, T18N, R1E. Found 3/4" Iron rod in mon. box per L.C.R.C., M.D.O.T. witness cards, and recorded survey. Fits occupation fence to E and M.D.O.T. call to M6-T18N-R1W. This position not established by original government surveyors. This monument is accepted as the best available evidence of the position of the corner. Accepted by Gladwin County Peer Review Group on 12-10-93.



C. Description of monument for corner and (if established) reestablished to perpetuate locating the position of the corner:

E-7 Could not remove 3/4" rod - drove down. Set Gladwin County aluminum cap on 5/8" x 24" rebar over rod in mon. box - 0.15' E of standard line, and 1.2' ± W of centerline M-30. N 86° E 152.97' to nail and tag in S side 14" Ash. SE 83.62' to nail and tag in NE side P.P. SW 83.22' to nail and tag in SE side P.P. S 70° W 93.57' to nail and tag in SE side 12" Cedar. N 20° W 187.17' to nail and tag in E side P.P. N 30° E 62.40 to face 4" pipe - oil line marker. W 0.15' and N 221.84' (220.90' M.D.O.T. and 221.76' (GLO)) to M5-T18N - R1W.

E-8 Could not remove 3/4" rod - drove down. Set Gladwin County aluminum cap on 5/8" x 36" rebar over rod in mon. box. S 19° W 169.20' to nail and tag in W side P.P. S 74° W 35.42' to nail and tag in N side 4" Pine. N 87° W 102.66' to nail and tag in N side 8" Pine. N 20° W 168.54' to nail and tag in S side P.P. S 75° W 54.82' to nail and tag in S side 2" Birch. North 242.48 (242.50 - M.D.O.T.) to M-6 - T18N - R1W.

Signed by Craig W. McVean, Surveyor's Michigan License No. 39088

Date 12/20/93