

OCT 23 1998

GLADWIN County Remonumentation

LIBER 001 PAGE 251

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

GLADWIN (County)	Located in:	Corner Code #
1. Public Land Survey	T18N R02E	C-9
	T R	
	T R	
	T R	
2. Property Controlling in Section:	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	

STATE OF MICHIGAN
GLADWIN COUNTY
FILED-CORNER

13 OCT 1998 12:53:23 PM

BONNIE K. HOUSE
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
	18	17	16	15	14	13						
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, Mark R Robison, in a field survey on April, 1998, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mention in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate

A. Description of original monument and accessories and/or subsequent restoration:

- C-9: 1846 John Mullett
 - Set Post Cor Sec's 19, 20, 29 & 30
 - Wit-(1)Y. Pine 12 N67E 9
 - (2)W. Pine 14 S33W 21
- 1972 Lapham working dwg R/R Iron
 - Wit-(3)S45E 8" Oak 55.6
 - (4)N15E 14" Oak 75.05
- 1992-97 DNR survey & LCRC#423
 - Set 5/8" x 36" roerod with cap
 - Wit-(5)6" W. Pine N35W 69.34
 - (6)5" Maple N25E 92.36
 - (7)14" Oak (CLP4) S40E 56.64
 - (8)5" J. Pine South 32.45

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- C-9: Found 5/8" x 34" roerod in centerline of E-W road, T-Road North. Corner set by DNR; restored from information of retracement survey by J. Meyers, P.S.#14099. Corner by DNR is part of their large retracement survey of T18N, R2E. Witnesses agree with corner location. See dossier and LCRC#423 for additional information.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


- C-9: Corner common to Sections 19, 20, 29 & 30. Accepted DNR corner location. Set Gladwin County Remonumentation cap marked P.S.#27458 on found 5/8" x 34" roerod.

Witnesses:
 South 6" Pine, nail & tag, 32.40'
 S40E 14" Oak, nail & tag, 56.65'
 N25E 5" Maple, nail & tag, 92.30'
 N35W 6" W. Pine, nail & tag, 69.45'

APPROVED LAND CORNER
 P.A. 345 of 1990
 Gladwin County

Co/Rep. J. Meyers
 Date 8/11/98

Surveyed by Mark R. Robison
 Surveyor's Michigan License No. 27458

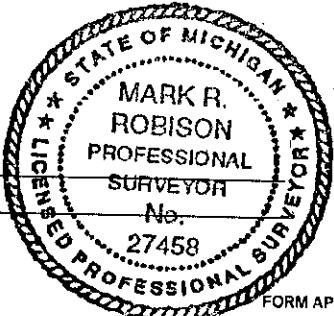

Date 10-5-98