LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in GLADWIN (County)

	Located In:	Corner Code ##
1. Public Land Survey	T 20N R 1E	L-9
	T ___ R ___	
	T ___ R ___	
	T ___ R ___	
2. Property Controlling	S 24 T ___ R ___	13, 16
in Section	S ___ T ___ R ___	
3. Miscellaneous	S ___ T ___ R ___	
Property in Sec.	S ___ T ___ R ___	

Register of Deeds Stamp & File Number

4. Lot No. _____ , Recorded Plat _____
5. Private Claims _____

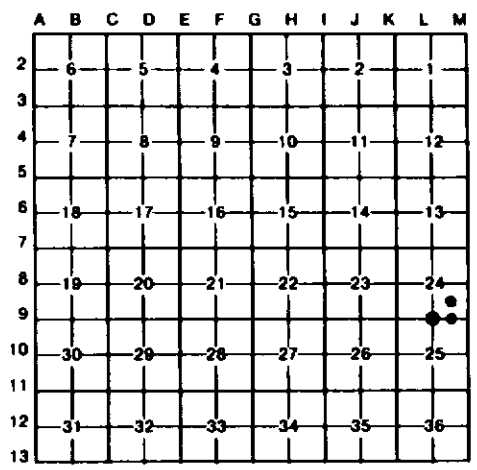

I, CARL T. KIISKILA , in a field survey on DECEMBER 20 , 19 94 , do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

L-9 13 16

(NO EVIDENCE OF G.L.O. CORNER, B.T'S, LINE TREES & TOPOGRAPHY, AS CALLED OUT IN THE G.L.O. LINE NOTES; UNLESS NOTED IN ITEM "B" BELOW.)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

L-9	13	16
FOUND AND ACCEPTED A 4" X 4" CONC MON AS FOUND AND USED BY G.HENNING IN 1966 SURVEY IN SEC 24.	ESTABLISHED THE NE COR OF THE SW 1/4 OF THE SE 1/4 SEC 24 BY STANDARD PROCEDURE FOR SUBDIVISION OF A SECTION. SURVEY DATA FOR THE W1/2 OF S-24 IS BASED ON A SURVEY BY RLS G.HENNING IN 1966.	ESTABLISHED THE SE COR OF SW 1/4 OF THE SE 1/4 SEC 24 BY STANDARD PROCEDURE FOR SUBDIVISION OF A SECTION.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

L-9			13			16		
FD 4" X 4" CONC MON WITH 3/8" REROD.			SET CAPPED 5/8" X 32" REROD & CEDAR POST.			SET CAPPED 5/8" X 32" REROD & CEDAR POST.		
24" R PINE	N10°E	17.11'	5" R PINE	S12°W	31.82'	6" OAK	N35°E	7.05'
4-6" TW MAPLE	N62°W	17.92'	5" R PINE	N82°E	14.75'	8" SPRUCE	N60°W	37.45'
16" OAK	N77°E	12.43'	6" W PINE	N26°E	24.32'	11" SPRUCE	S41°W	22.33'
4" W PINE	S54°W	32.86'	16" MAPLE	N12°W	44.90'	8" TAMARACK	S45°E	29.81'
			CTR N-S TWO-TRACK	EAST	34'	ALL TREES HAVE UPPER BLAZES.		
ALL TREES HAVE UPPER BLAZES.			ALL TREES HAVE UPPER BLAZES.					

STATE OF MICHIGAN
CARL KIISKILA
LAND SURVEYOR
No. 33981
LICENSED LAND SURVEYOR

Signed by Carl T Kiiskila Date 1-23-96

Surveyor's Michigan License No. 33981

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983