

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. PA 1970

For Corners In: Gladwin Located In _____ Corner Code # _____
(County)

1. Public Land Survey	T	<u>20N</u>	R	<u>2E</u>	<u>F11</u>
	T	_____	R	_____	_____
2. Property Controlling in Section	S	_____	T	_____	R
	S	_____	T	_____	R
3. Miscellaneous Property in Section	S	_____	T	_____	R
	S	_____	T	_____	R


Register of Deeds Stamp & File Number

4. Lot No: _____ Recorded Plat: _____

5. Private Claims: _____

I, Craig W. McVean, in a field survey on March 1, 2006 do hereby state that under requirements of PA 74, Michigan PA of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

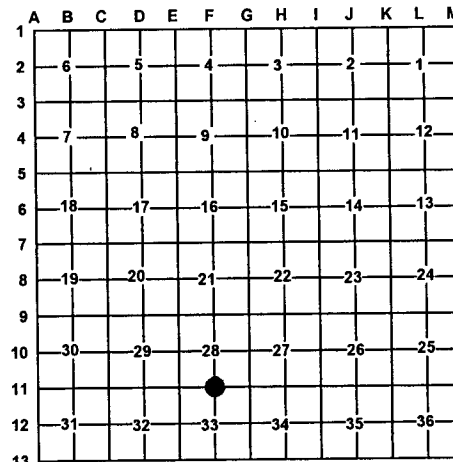

A. Description of original monument and accessories and/or subsequent restoration:

F11 – GLO – J. Mullett – 1846 – Set Post
Cedar 8" S32°E 12 L.
B. Ash 8" N35°W 7 L.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

F11 – ¼ corner common to Sections 28 & 33, T20N, R2E - Found no evidence of original GLO corner or witnesses. Set DNR monument by single proportion to GLO between Fd. 'G11' and 'E11'. Corner falls in B. Ash swamp in line with Gravel Rd. East & 21' W of centerline of Gravel Rd. S. Remains of overgrown 2-track CCC Rd. to West. DNR mon. accepted as a careful and faithful reestablishment of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

F11 - Stamped 4" DNR Aluminum cap on 1" x 5' long galv. iron pipe.
N56°W 7.57' to set N & T in NE side 6" Elm scribed 'XBT'
S37°W 29.38' to set N & T in NW side 3" W. Birch scribed 'XBT'
N80°E 35.87' to set N & T in S side 6" Willow
N33°E 19.94' to set N & T in SE side 7" Ash scribed 'XBT'
Set Blue Carsonite Post 1' North



Signed by: Craig W. McVean
Surveyor's Michigan License No.: 39088

Date: 5/9/2007