


LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. PA 1970

For Corners In: <u>Gladwin</u> (County)	Located In	Corner Code #
1. Public Land Survey	T <u>20N</u> R <u>2E</u>	<u>I-13</u>
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No: _____	Recorded Plat: _____	
5. Private Claims: _____		

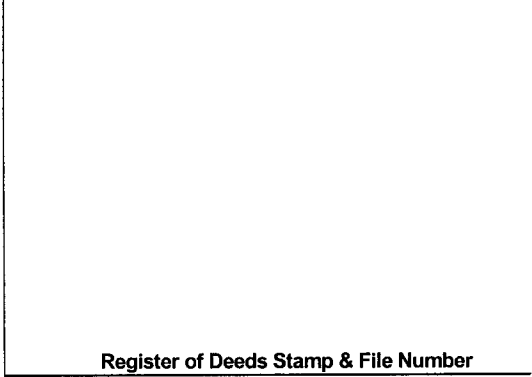

I, Craig W. McVean, in a field survey on Aug. 26, 2004 do hereby state that under requirements of PA 74, Michigan PA of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A. Description of original monument and accessories and/or subsequent restoration:

I-13 – GLO – Set Sec. Post – L. Clason – 1837
 W. Pine 30" N25°E 21 L.
 Hemlock 12" N51°W 44 L.
 - CCC Notes – 1930's – West on N. bdy of Sec. 2,
 T19N, R2E. 160 CH – Set random mile post. Sec. post is 94 ½ N and 3 E. of Random.
 Mile is 80.06

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

I-13 – Standard Corner common to Sec. 34 & 35, T20N, R2E – Fd. bent 1 ½" iron pipe that fits remains to ground of WPS at N25°E 14'±.
 Also found 1 ½" pipe for 'I-1', T19N, R2E in agreement w/ GLO closing distance. Appears CCC found original position here.
 1 ½" iron pipe accepted as a careful and faithful perpetuation of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I-13 – Drove stamped 2 ½" Alum. Cap on 5/8" x 34" iron rebar into center of found 1 ½" iron pipe. Cut off bent part.
 Set Blue Carsonite Post 1' N
 East 8.43' (8.58' – GLO) to 'I-1', T19N, R2E – 2 ½" Alum. Cap in 1 ½" pipe
 N25°E 14.69' to set spike in centerline remains WPS (GLO)
 N45°W 44.28' to set ½" x 18" rebar
 S11°W 68.48' to set N & T in E. side 2" Oak.



Signed by: Craig W. McVean
 Surveyor's Michigan License No.: 39088

Date: 5/9/2007