LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in GLADWIN (County)

	Located In:	Corner Code ##
1. Public Land Survey	T 20N R 2E	B-6, B-7,
	T ___ R ___	C-7
	T ___ R ___	
	T ___ R ___	
2. Property Controlling	S 18 T ___ R ___	12
in Section	S ___ T ___ R ___	
3. Miscellaneous	S ___ T ___ R ___	
Property in Sec.	S ___ T ___ R ___	

Register of Deeds Stamp & File Number

4. Lot No. _____ , Recorded Plat _____
5. Private Claims _____

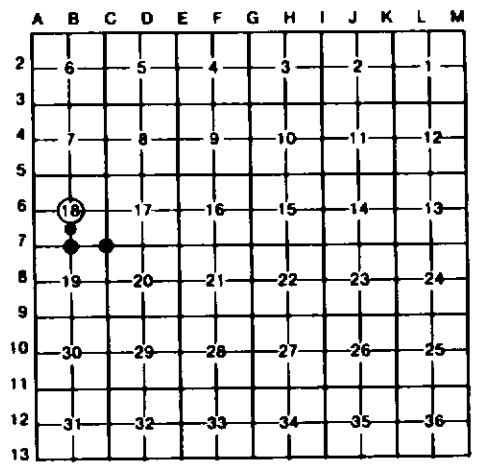

I, CARL KIISKILA , in a field survey on NOVEMBER 10 , 19 94 , do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

B-6 B-7 C-7

(NO EVIDENCE OF G.L.O. CORNER, B.T'S, LINE TREES & TOPOGRAPHY, AS CALLED OUT IN THE G.L.O. LINE NOTES; UNLESS NOTED IN ITEM "B" BELOW.)

12

STATE OF MICHIGAN
CARL KIISKILA
LAND SURVEYOR
No. 33981
LICENSED LAND SURVEYOR

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

B-6
ESTABLISHED THE CENTER OF SECTION 18 BY STANDARD PROCEDURE FOR SUBDIVISION OF A SECTION.

B-7
FOUND AND ACCEPTED A 1/2" IRON PIPE SET BY GEORGE HENNING DURING A SECTION BREAK DONE (SEC 18) IN 1967.

C-7
FOUND AND ACCEPTED A CEMENT NAIL FOR THE NE COR OF SEC 19, AGREES WITH WORK DONE BY G.HENNING IN SECTION 18. COR IS IN CENTERLINE N-S BLACK TOP ROAD.

12
ESTABLISHED THE NE CORNER OF THE SE 1/4 OF THE FRL SW 1/4 SECTION 18 BY STANDARD PROCEDURE FOR SUBDIVISION OF A SECTION.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

B-6
SET DNR MON & CED POST.

4" RED PINE	S59°E	6.15'
8" TW RED PINE	N22°E	18.91'
10" W PINE	N51°W	28.43'
14" RED PINE	S62°W	17.74'

UPPER BLAZES & SIDE NAILS.

B-7
FOUND 1/2" IRON PIPE. SET CED POST.

12" ASH	N47°E	36.45'
*12" POPLAR	S16°E	9.74'
*6" ASH	S49°W	16.28'
5" ASH	N20°W	15.48'

UPPER BLAZES & SIDE NAILS.

*WIT BY J.RICHARDSON,RLS #2527

C-7
FD NAIL. REPL'D WITH 5/8"x 16" REROD W/CAP, 1'±E OF CTR. BLACK TOP ROAD.

6" W BIRCH	S66°W	64.16'
10" UTILITY POLE	N26°W	63.12'
8" ASPEN	S53°E	47.26'
14" ASPEN	N85°E	48.52'

12
SET 5/8"x 32" REROD W/CAP & CED POST.

12" MAPLE	S74°E	13.42'
10" MAPLE	S22°E	7.48'
16" MAPLE	NORTH	19.93'
8" MAPLE	S76°W	35.02'

UPPER BLAZES & SIDE NAILS.

Signed by Carl T Kiiskila Date 1-23-96

Surveyor's Michigan License No. 33981

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983