

**SURVEY & REMONUMENTATION**

GLADWIN COUNTY REMONUMENTATION

DEC 16 1996

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

LIBER 001 PAGE 155

For corners in COMMISSION

GLADWIN (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>20N</u> R <u>1W</u>	<u>G - 9</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

STATE OF MICHIGAN  
GLADWIN COUNTY  
FILED-REMONUMENTATION

2 DEC 96 3:35 P.M.

BONNIE K. HOUSE  
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

I, MARK ROBISON, in a field survey on November, 19 96 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

- 1856 GEO E ADAIR (6)NW 63.6 P.P.
- SET POST (7)SE 58.6 T.P.
- WIT.-(1)W. PINE 13 N74E 36
- (2)CEDAR 15 S74W 44
- 1907 KNOX SURVEY
- FOUND IRON BOLT 18" X 1"
- WIT.-NONE
- 1960+- DUNDAS & EDMANDS
- WIT.-(3)NE 37.3 COR POST
- (4)SE 48 P.P.
- (5)NE 45.6 COR F.P.
- 1973 PAUL LAPHAM WORKING DWG
- 1975+- PAUL LAPHAM-PLAT OF BERKSHIRE REALM
- 1980 PAUL LAPHAM WORKING DWG
- 1987 EDMANDS ENG-ROAD PLANS
- WIT.-(8)NW 50.5 TO SCS B.M. IN U.P.
- (9)SW 88.8 TO C/L S END 18 CMD
- (10)NE 111.6 TO C/L 4" ASH TREE
- 1994 PAUL LAPHAM SURVEY

FOUND 1/2" IRON  
WIT.-(11)N60W 50.6 P.P.  
(12)N45E 38.15 TELE POLE  
(13)S45W 41.00 FENCE COR  
1994 PAUL LAPHAM SURVEY  
WIT.-SAME AS (10),(11)&(12)  
1986 PAUL LAPHAM MEAS TO G-8, 2652.72

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FOUND 1/2" X 18" REROD OVER 1/2" X 18" REROD, BENT, 16" BELOW SURFACE OF ASPHALT ROAD INTERSECTION IN OLD ROADBED. FOUND WITNESSES (8) & (11); REC. & MEAS. 50.6. FOUND COR AGREES WITH SOUTH LINE OF PLAT OF BERKSHIRE REALM AND PREVIOUS MEAS TO NORTH (G-8), 2652.72. SET GLADWIN REMON FROM FOUND IRONS & WITNESSES (8) & (11).

APPROVED LAND CORNER  
P.A. 74 of 1970  
Gladwin County


SEE DOSSIER FOR DETAILED REPORT.

Co. Rep. Mark Robison  
Date 11/6/96

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

G-9: CORNER COMMON TO SECTIONS 21, 22, 27 & 28  
SET 5/8" X 36" REROD WITH GLADWIN REMON CAP MARKED P.S.#27458 IN MONUMENT BOX.

- WITNESSES:
- N60W POWER POLE, SCS TAG, 50.60'
- S20W POWER POLE, N&T, 160.00'
- N45E 6" ASH, N&T, 111.65'
- N18W 4" B. WOOD, N&T, 191.05'
- NORTH, P.K. NAIL, 2.0'
- EAST, P.K. NAIL, 2.0'

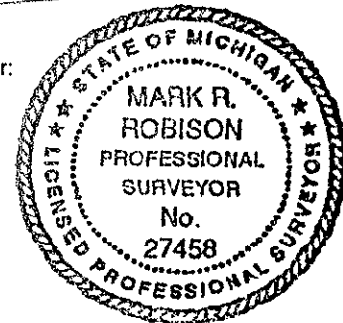

Signed by Mark R. Robison  
Surveyor's Michigan License No. 27458

Date 11-29-96