

SURVEY & REMONUMENTATION COMMISSION
APR 07 1995

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

Register's Office }
 Gogebic County } ss.

Received for record the
6TH day of DECEMBER
 A. D. 1994 at 10:00 o'clock
A m., and recorded in
 Liber 5 of CORNERS
 on page 161
Ramona Collins DePatty
 Register of Deeds

Register of Deeds Stamp & File Number

For corners in Gogebic (County) Located In: _____ Corner Code # _____

1. Public Land Survey	T <u>45N</u> R <u>43W</u>	<u>B-3</u>
SEC. 7	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling	S _____ T _____ R _____	_____
in Section	S _____ T _____ R _____	_____
3. Miscellaneous	S _____ T _____ R _____	_____
Property in Sec.	S _____ T _____ R _____	_____

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

One-quarter corner common to Sections 6 & 7, T45N, R43W

I, John R. Garske, in a field survey on October 19, 1994, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

Survey by Algemon Merryweather in 1852. Corner is 8" sugar - corner tree - a 24" birch bears S10°E, 20 links.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I set a mathematical position from which to search, however, no original evidence could be found due to logging activity.

Corner was established by single proportional measurement. I set the corner on line between the meander corner common to Section 6 and 7 on Hawk Lake and the section corner common to Sections 5, 6, 7 and 8 at a proportional distance in accordance with the original field notes.

PEER GROUP


Approved

Richard L. Drake

11/30/94

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set a 2 1/2" diameter x 30" long Bernsten aluminum monument with a 3 1/4" aluminum cap stamped: 1/4; T45N, R43W; S-6; S-7; 1994, RLS 28410. Established the following bearing trees and reference objects: 6" red maple - N17°E, 6.37 feet; 6" W. spruce - S45°E, 50.56 feet; 6" W. spruce - S29°W, 53.79 feet; 6" balsam fir - N68°W, 16.55 feet; 6 foot steel rail with sign

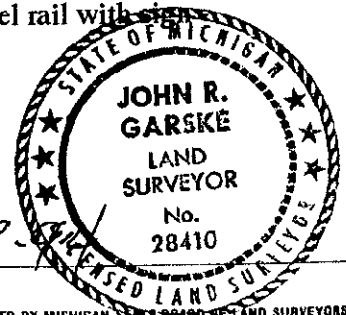

Signed by John R. Garske

Date 11-8-94

Surveyor's Michigan License No. 28410