

**SURVEY & REMONUMENTATION**

AUG 08 1997

COMMISSION

**LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners of Gogebic  
(County)

Located In:

Corner Code #

1. Public Land Survey	Section 2	T <u>46N</u> R <u>45W</u>	<u>I-13</u>	
		T <u>45N</u> R <u>45W</u>	<del>I-13</del>	
2. Property Controlling in Section	S	T	R	
	S	T	R	
	S	T	R	
	S	T	R	
3. Miscellaneous Property in Section	S	T	R	
	S	T	R	
	S	T	R	
	S	T	R	

Register's Office }  
Gogebic County } ss.

Received for record the  
16<sup>th</sup> day of July  
A. D. 1997 at 1:40 o'clock  
P m., and recorded in  
Lib. 6 of CORNERS  
on page 158  
Colleen M. Kitchin  
Deputy Register of Deeds

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims  
Section Corner common to sections 2, 3, 34, 35, T46N, T45N, R45W

A	B	C	D	E	F	G	H	J	K	L	M
2	6	5	4	3	2	1					
3											
4	7	8	9	10	11	12					
5											
6	18	17	16	15	14	13					
7											
8	19	20	21	22	23	24					
9											
10	30	29	28	27	26	25					
11											
12	31	32	33	34	35	36					
13											

I, John R. Garske, in a field survey on June 4, 1997, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

In 1847, John Burt D.S., and Austin Burt, D.S., set a sugar post which a  
8" sugar N54E 48 lks.  
16" sugar N66W 28 lks.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


I found a 2 1/2" Iron Pipe with a scribed wood post. 1935 U.S.F.S. form 8-74 notes a recovered Cedar post at the corner and two of the original bearing trees. He placed a location poster on an 8" maple 8 ft. west of the corner. We were unable to find any on the original bearing trees or the location poster. Blue lines run in all four directions from the iron pipe. This corner location has been used and accepted since the mid 40's as noted by Keweenaw lands records and is consistent with GLO natural features.

Corner research on file.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I set a 2 1/2" diameter 30" long aluminum pipe with a 3 1/4" aluminum cap stamped county remonumentation, T46N, T45W, 34, 35, 2, R.L.S. 28410 6-4-97. The following witness objects were established:  
6" maple N70°W 32.80 ft.  
7" maple N12°E 25.62 ft.  
6" maple S07°W 24.31ft.  
6' steel sign rail east 1.71'

PEER GROUP APPROVED  
Richard P. Duda 7/15/97  
COUNTY REPRESENTATIVE

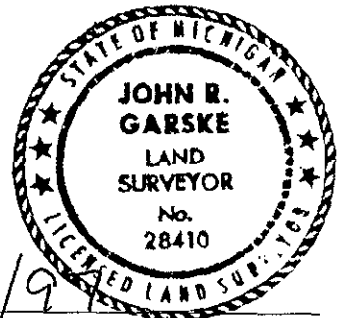

Signed by John R. Garske  
Surveyor's Michigan License No. 28410

Date 7/15/97