

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

GOGEBIC COUNTY

Register's Office }  
Gogebic County } ss.

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 46 N. <del>X.</del> , R. 44 X. W.	A-11
2. PROPERTY CONTROLLING IN SECTION	T. <u>46</u> N. <del>X.</del> , R. <u>45</u> X. W.	<u>M-11</u>
3. MISCELLANEOUS PROPERTY IN SECTION	T. _____ N. _____, R. _____ E. _____ W. _____	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

Section corner 30, 31, 25 and 36; T46N, R44-45W.

Received for record the  
5<sup>TH</sup> day of JANUARY  
A. D. 1994 at 10:06 o'clock  
A m., and recorded in  
Liber \_\_\_\_\_ of \_\_\_\_\_  
on page 351.  
*Betty Searis, Deputy*  
Register of Deeds

REGISTER OF DEEDS STAMP AND  
FILING NUMBER

I, Richard L. Drahn do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on June 16 1993, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_ 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

**A. Description of original monument and accessories and/or subsequent restoration:**

Original corner established by Austin Burt, U.S. Deputy Surveyor on August 30, 1847.  
Original bearing trees:

Fir	10"	S.63 1/2° E.	31 links	(20.46 feet)
Fir	12"	N.59° W.	17 links	(11.22 feet)
Y. Birch	20"	S.86° W.	21 links	(13.86 feet)
Fir	8"	N.53° E.	33 links	(21.78 feet)

22.91 chains north "Y. Birch 18" diameter" line tree.  
No record of subsequent corner restoration found.

**B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:**

No evidence remains of the fir bearing trees. Restored corner position by proportionate measurement from G.L.O. 1/4 north 40 chains, through recovered line tree stump at 22.91 chains north, to corner location. At a point S.86°W., 13.9 feet from the restored location I recovered the badly decayed remains of a very large wind-thrown yellow birch. Corner location lays within 1.6 feet of a single proportionate analysis of the west range line of T.46N., R.44W. No evidence found of subsequent corner restoration.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

At the corner position I set a standard 2 1/2" diameter by 30" long split base aluminum monument with a 3" cast aluminum cap, stamped to read: T46N, R44-45W; S-30, S-31, S-25, S-36; 1993; R.L.S. 21564. From which I have established the following new blazed and scribed bearing trees:

10"	Sugar Maple	N.23°E.	10.50 feet
11"	Red Maple	S.47°E.	25.81 feet
6"	Sugar Maple	N.82°W.	22.02 feet
6'	Steel rail	N.81°E.	1.48 feet

**PEER GROUP APPROVED**  
*Richard L. Drahn 1/20/94*


SIGNED BY \_\_\_\_\_ COUNTY REPRESENTATIVE DATE \_\_\_\_\_

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

APPROVED AND SIGNED BY Richard L. Drahn CHIEF OF SURVEY PARTY DATE December 20, 1993  
MICHIGAN REGISTERED LAND SURVEYOR

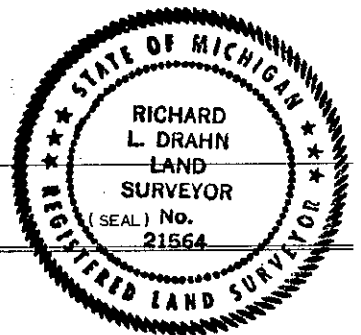

FED. V-1

SURVEYOR'S MICHIGAN REGISTRATION NO. 21564