

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

GOGEBIC COUNTY

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. 46 N. <del>X</del> R. 44 <del>X</del> W.	A-12
2. PROPERTY CONTROLLING IN SECTION _____	T. 46 N. <del>X</del> R. 45 <del>X</del> W.	M-12
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. _____ R. _____ E. _____ S. _____ R. _____ W. _____	_____
4. LOT NO. _____, RECORDED PLAT _____	_____	_____
5. PRIVATE CLAIMS _____	_____	_____

Quarter corner 31 and 36; T46N, R44-45W.

Register's Office }  
Gogebic County } ss.

Received for record the  
5<sup>th</sup> day of JANUARY  
A. D. 1994 at 10:05 o'clock  
4 m., and recorded in  
Liber 4 of CORNER  
on page 352.  
*Betty L. Davis* Deputy  
Register of Deeds

REGISTER OF DEEDS STAMP AND  
FILING NUMBER

I, Richard L. Drahn do hereby certify that under requirements of P.A.74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on October 25 1993, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_ 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

**A. Description of original monument and accessories and/or subsequent restoration:**

Original corner established by Austin Burt, U.S. Deputy Surveyor, on August 30, 1847.

Original bearing trees:

Fir	10"	S.30°E.	28 links	(18.48 feet)
Fir	10"	N.35°W.	16 links	(10.56 feet)

40.00 set hemlock post - - - -  
40.50 a yellow birch 18 in. diameter  
No record of subsequent corner restoration found.

**B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:**

No evidence found of original Fir bearing trees. Restored corner position 50 links south of the recovered original yellow birch line. It is now a badly decayed 30-34" broken yellow birch stub; the only old growth yellow birch remains recovered in the area. Corner location falls within one foot of my mathematical analysis of 5 miles of range line.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

At the corner position I set a standard 2 1/2" diameter by 30" long split base aluminum monument with a 3" cast aluminum cap, stamped to read: T46N, R44-45W.; 1/4; S-31, S-36; 1993; R.L.S. 21564. From which I have established the following new blazed and scribed bearing trees:

10"	Sugar Maple	S.30°E.	26.66 feet
17"	Hemlock	S.54°W.	54.87 feet
10"	Sugar Maple	N.42°W.	46.69 feet
6'	Steel rail	N.37°E.	1.48 feet

**PEER GROUP APPROVED**

*Richard L. Drahn* 1/20/94

SIGNED BY \_\_\_\_\_ COUNTY REPRESENTATIVE DATE \_\_\_\_\_

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

APPROVED AND SIGNED BY *Richard L. Drahn* CHIEF OF SURVEY PARTY DATE December 20, 1993

MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

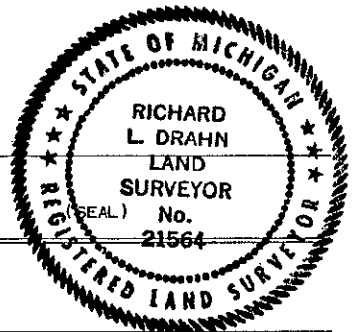

FED. X-1

SURVEYOR'S MICHIGAN REGISTRATION NO. 21564