

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

Register's Office }  
 Gogebic County } ss.

Received for record the  
7<sup>TH</sup> day of NOVEMBER  
 A. D. 1995 at 1:15 o'clock  
P m., and recorded in  
 Liber 5 of CORVERS  
 on page 302,  
Ramona Collins, Deputy  
 Register of Deeds

Register of Deeds Stamp & File Number

For corners in

<u>Gogebic</u> (County)	Located In:	Corner Code #
1. Public Land Survey S-26	T <u>47N</u> R <u>42W</u>	<u>K-10</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_  
 One-quarter corner common to Sections 26 & 25, T47N, R42W

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, John R. Garske, in a field survey on November 2, 19 95, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

**A. Description of original monument and accessories and/or subsequent restoration:**

- Set by A. Merryweather, June 1851 - Set 1/4 post from which a 20" birch bears N44°W - 6 links, and a 12" hemlock S75°E - 17 links.
- 1990 survey by J.R. Garske, R.L.S. 28410. Reestablished the corner position as recorded in Liber 4, Page 38. Corner set consisted of a 2" x 30" iron pipe with a brass cap stamped: T47N, R42W, 1/4, S-26, S-25, 1990, R.L.S. 28410. Bearing trees and reference object:
  - 4" maple - N87°E - 4.97 feet
  - 10" maple - S18°E - 21.14 feet
  - 7" maple - S40°W - 12.58 feet
  - 5/8" rebar - S30°E - 0.50 feet

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

Found the brass capped 2" iron pipe as noted above in Section "A" and updated the corner position to state and county specifications as noted below.


Act 74 record on file with Register of Deeds office.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

The corner position is marked by a brass capped 2" iron pipe as described above. I established the following bearing trees and/or reference objects:

- 4" maple - N87°E - 4.97 feet (existing)
- 10" maple - S18°E - 21.14 feet (existing)
- 7" maple - S40°W - 12.58 feet (existing)
- 5/8" rebar - S30°E - 0.50 feet (existing)
- 6" steel rail with sign - N45°W - 0.70 feet

PEER GROUP APPROVED  
Richard H. Drahn 11/6/95  
 COUNTY REPRESENTATIVE

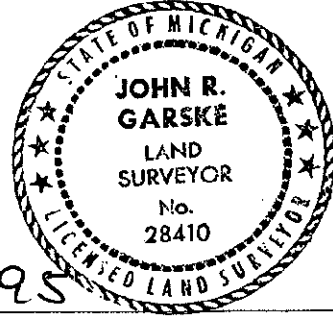

Signed by John R. Garske  
 Surveyor's Michigan License No. 28410

Date 11-6-95