

SURVEY & REMONUMENTATION

SEP 08 1998

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

Register's Office }
Gogebic County } ss.

For corners in

Gogebic
(County)

Located In: Corner Code #

- 1. Public Land Survey T 47N R 44 W M-7
T _____ R _____
T _____ R _____
- 2. Property Controlling in Section S _____ T _____ R _____
S _____ T _____ R _____
- 3. Miscellaneous Property in Sec. S _____ T _____ R _____
S _____ T _____ R _____

Received for record the
14TH day of MAY
A. D. 1998 at 3:30 o'clock
P m., and recorded in
Liber 6 of CORNERS
on page 387
Rymona Collins Dep.
Register of Deeds

Register of Deeds Stamp & File Number

- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

Section Corner 13, 24, 18 & 19; T.47 N., R.43-44 W.

I, Richard L. Drahn in a field survey on April 20, 1998, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

Corner established by William Burt in 1848. Original B.T.s --- B. Ash 10" S.46 W. 15 links (9.90') --- B. Ash 10" N.28 E. 29 links (19.14') --- Cedar 10" S.26 E. 6 links (3.96') --- B. Ash 12" N.35 E. 32 links (21.12') --- Corner restored by Donald D. Lappala (12585) on 6/17/71 from the remains of the first two B.T.s (the second one still scribed). He set a 2 1/2" iron pipe with a 3" stamped brass cap and the following new bearing trees:

- 6" Yellow Birch N.06 E. 16.2'
- 6" Yellow Birch N.65 E. 7.7'
- 10" Cedar S.80 W. 26.9'
- 4" X 4" X 7' Cedar post N.65 W. 2.0'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Corner recorded in Gogebic County in USFS Liber Page N-25 on 8/10/72.

Corner research on file with Gogebic County records.

Recovered the monument as described and the bearing trees as follows:

- 6" Yellow Birch N.07 E. 16.05' (new nail)
- 7" Yellow Birch N.68 E. 7.70' " "
- 11" Cedar S.80 W. 27.04' " "
- 4 X 4 X 7' Cedar post N.56 W. 1.97'

A stump hole still remains from the first original B.T. and a decayed Black Ash stump remains from the second. No evidence remains of the last two B.T.s.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

New bearing objects referenced:

- 6" Yellow Birch S.11 W. 23.35'
- 6' Steel sign rail S.10 W. 2.41'

PEER GROUP APPROVED

Richard L. Drahn 5/13/98
COUNTY Surveyor

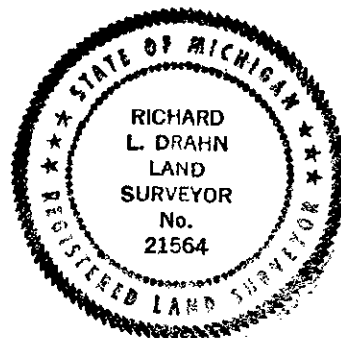

Signed by Richard L. Drahn Date April 22, 1998
Surveyor's Michigan License No. 21564