

SURVEY & REMONUMENTATION

OCT 03 1996

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in Gogebic
(County)

Located in:

Corner Code #

1. Public Land Survey Section 28	T	47N	R	46W	F-11
	T		R		
	T		R		
	T		R		
	T		R		
2. Property Controlling in Section	S		T		R
	S		T		R
3. Miscellaneous Property in Section	S		T		R
	S		T		R

Register's Office } ss.
Gogebic County }

Received for record the
16th day of August
A. D. 1996 at 11:10 o'clock
A m., and recorded in
Liber 6 of 4 CORNERS
on page 16;
Raymond Collins, Deputy
Register of Deeds

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

One-quarter Sections 28 and 33, T47N, R46W.

I, John R. Garske, in a field survey on July 3, 1996, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:


Original survey by Austin Burt in 1851. He set a post with bearing trees: 10" fir - S53°E - 9 links
8" yellow birch - N18°W - 16 links.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I established the corner at the centerline intersection of Spruce and South Barber Roads. This corner location fits well with occupation/fence lines east and west. In addition, measurements to monumented corners east (2662.91') and west (2646.93') were taken to verify this position.

Record Research on file.

PEER GROUP APPROVED
Richard P. Drexler 8/14/96
COUNTY REPRESENTATIVE

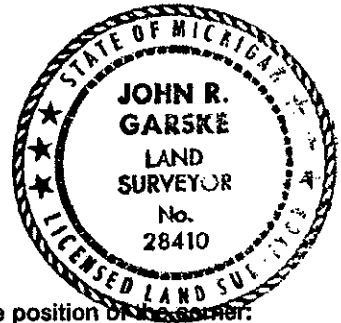

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I set a 5/8" rebar capped with a 3 1/4" diameter aluminum cap stamped: County Remonumentation, T47N, R46W, 1/4, S-28, S-33, 1996, R.L.S. 28410, from which I established the following reference objects and bearing trees:

- 6" cherry - S45°W - 40.78 feet
- 7" Aspen - N57°W - 79.23 feet
- 10" Tamarack - N73°E - 155.26 feet

A reference monument consisting of a 2 1/2" diameter x 30" aluminum pipe with a 3 1/4" diameter aluminum cap stamped: County remonumentation, T47N, R46W, R.M., 1/4, S-28, S-33, 1996, R.L.S. 28410, N43°W, 54.47 feet
6' Steel rail with sign 0.95 feet away

Signed by John R. Garske
Surveyor's Michigan License No. 28410

Date 8-4-96