## LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

<b>NTE</b>	Register's Office ss.
970	Received for record the
	215 day of Tuer
	A. D. 1995 at 1:35 o'clock
	Liber 5 of CORNERS
	page 267
	Ramona Collins Diouts
	page 267 Commona Colling Diputy Register of December
Regist	er of Deeds Stamp & File Number


For corners in Gogebic Located in: Corner Code ## T47N R 46W 1. Public Land Survey R 2. Property Controlling S \_\_\_\_\_ T \_\_\_ in Section Miscellaneous \_\_\_\_ T \_\_\_\_ R Property in Sec.

\_ , Recorded Plat \_ 5. Private Claims \_

Sec. Cor. Comm. to Sec's. 1,2,11 & 12

May 12 John P. Goss , in a field survey on \_ do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

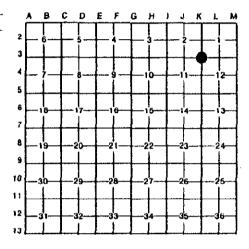

A. Description of original monument and accessories and/or subsequent restoration:

Original corner established by Austin Burt on June 10, 1851. Set post. Original bearing trees:

S 38° E 12" Aspen N 180 W 36 links Aspen 8"

In 1983 John P. Goss found a 1/2" rebar using MDOT plans and recorded this corner in Liber 2 on page 490 of Land Corners for Gogebic County. Established the following witnesses and distances: P.Pole-N 55° E-38.17'; Face side of stop sign post- S 65° W- 37.45'; NE corner of garage- N 19° W- 93.73'.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found the 1/2 inch rebar marking the corner position and it checked with the witnesses in John P. Goss certification. I updated the corner monument and accessories as noted below to state and county specification.

Act 74 reseach on file with the County Register of Deeds Office.

PEER GROUP APPROVED REPRESENTATIVE COUNTY

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set a 21 brass cap with a 2" stem at 1" below asphalt road surface. Cap is stamed: T47N, R46W; S-1, S-2, S-11, S-12; 1995; P.S. 23509. I established the following bearing trees and reference objects. OF MICHIGAN

P.Pole

N 550 E \$ 43° W

38.17 63.591

5" Apple

и 330 %

59.681

Reference Monument consisting of a 22" x 30" aluminum monument with a 31 aluminum cap

stamped to indicate corner position - S 29° E-59.01' with a 6' steel rail and sign at 1.49'.

\_\_ Date \_

May 13, 1995

Fed. No. E - 21

P.S. 23509

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1975 REVISED MAY 14, 1975