

SURVEY & REMONUMENTATION

SEP 29 1994

COMMISSION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

Register's Office } ss.
Gogebic County }

For corners in

Gogebic
(County)

Located in:

Corner Code #/

- 1. Public Land Survey Section 10 T 47N R 47W I-4
 T _____ R _____
 T _____ R _____
 T _____ R _____
- 2. Property Controlling in Section S _____ T _____ R _____
 S _____ T _____ R _____
- 3. Miscellaneous Property in Sec. S _____ T _____ R _____
 S _____ T _____ R _____

Received for record the
16 day of SEPT.
A. D. 1994 at 3:50 o'clock
7 m., and recorded in
Liber 5 of CORNERS
on page 112
Ramona Collins, Deputy
Register of Deeds

Register of Deeds Stamp & File Number

- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

Section corner common to Sections 10 & 11, T47N, R47W

June 20 94

I, John R. Garske, in a field survey on _____, 19____, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

Original survey by William Ives, D.S., in 1848. Set wood post. Original bearing trees: Fir 8" - N17°E, 16 links; Cedar 8" - S70°W, 4 links.

The one-quarter corner position was found by John P. Goss, RLS 23509 in September of 1981 consisting of a brass cap in concrete pavement set by the U.S.D.A. Farm Security Administration in 1938. He recorded the corner in Liber 2 of land corners, P. 126. Accessories: P. pole - N38°E, 64.56 feet; T. pole - S17°W, 85.14 feet; Elm 17" - Due West, 43.20 feet.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found a bolt marking the corner position as set per J. Goss, County Road Commission, after road reconstruction. I updated the corner as noted below to bring it up to county and state specifications.

Act 74 research on file with County Register of Deeds Office.

PEER GROUP

Approved

Richard L. Drahn


9/14/94

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I replaced the found bolt with a 2 1/2" brass cap with 2" stem in anchoring cement. Cap is stamped: S-10, S-11, T47N, R47W, 1/4, 1994, RLS 28410. I established the following bearing trees and reference objects: A reference monument consisting of a 2 1/2" x 30" aluminum pipe with a 3" aluminum cap stamped to indicate the corner position as follows: R.M. - S85°E, 33.32 feet with a steel sign post N55°W, 1.38 feet away; P. pole #10 - 99/52 - N32°W, 65.46 feet; P. pole #50 - N38°E, 64.33 feet; P. pole - S23°W, 85.40 feet.

Signed by John R. Garske
Surveyor's Michigan License No. 28410

Date 8/30/94

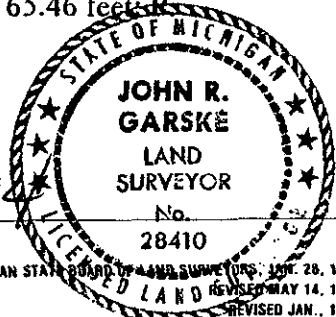

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 26, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983