## SURVEY & REMONUMENTATION

OCT 0 3 1996

## COMMISSION For corners in

## LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

Register's Office Gogebic County ss.

<b>9</b> /U	,
	Received for record the
	23 PD day of FEB.
	A. D. 19.96. at 1:35 o'clock
	Pm., and recorded in
	Liber 5 of CORNERS
	page323
	Kamona Calina, Oppitte
	Register of Doods
Regi	ster of Deeds Stamp & File Number

~	Gogebic (County)	Located In:	Corner Code ≠
1.	Public Land Survey	T 48N R 44 W.	<u>I-5</u>
		T R	
2.	Property Controlling in Section	S T R S T R	
3.	Miscellaneous Property in Sec.	S T R S T R	


4. Lot No. \_\_\_\_\_\_, Recorded Plat \_\_\_\_\_\_

5. Private Claims \_\_\_\_\_

Sec. Cor. 10,11, 14 & 15; T.48 N., R.44 W.

Richard L. Drahn in a field survey on November 17 19 95, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

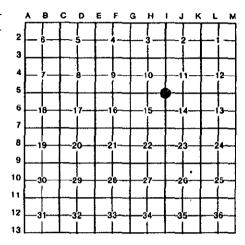

A. Description of original monument and accessories and/or subsequent restoration:

Corner established by Austin Burt in 1848. Original B.T.s --- Yellow Birch 20" S.09 E. 28 links (18.48') --- Yellow Birch 18" N.43 W. 4 links (2.64').

Corner restored by Donald D. Lappala, RLS 12585 on 8/13/68 from the scribed remains of the two original bearing trees. He set a 2" x 5' iron pipe monument with a 3" stamped brass cap and the following new bearing trees: --- 7' Cedar (now dead and down) N.24 W. 47.7' --- 12" (15") Cedar N.49 E. (N.51 E.) 38.4' (38.44') --- 6" (9") Hemlock N.84 W. (N.83 W.) 23.7' (23.55').

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Recovered the monument as described and the bearing trees as noted in parentheses above. The original SE bearing tree is now a decayed Yellow Birch stump. Fragments of Y. Birch bark remain from the NW original B.T.

Corner recorded in Gogebic County in Liber USFS, Page I-5, 3/31/69.

Act 74 research form on file with Gogebic County records.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

New bearing objects referenced:

8" Red Maple

S.20 E.

8.561

6' Steel sign rail S.41 W.

2.15'

Resource grade GPS

Surveyor's Michigan License No. \_

Lat. 46 - 33.892 N. Long. 89 - 46.938 W.

COUNTY BEVERENTATIVE

RICHARD
L. DRAHN
LAND
SURVEYOR
No.
21564

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971

Signed by _	Richard	RN	zalin	
•				

Date December 12, 1995