

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

<u>Gogebic</u> (County)	Located In:	Corner Code #
1. Public Land Survey	<u>T48 N R45 W.</u>	<u>H-9</u>
	T <u>    </u> R <u>    </u>	
	T <u>    </u> R <u>    </u>	
	T <u>    </u> R <u>    </u>	
2. Property Controlling in Section	S <u>    </u> T <u>    </u> R <u>    </u>	<b>SURVEY &amp; REMONUMENTATION</b>
3. Miscellaneous Property in Sec.	S <u>    </u> T <u>    </u> R <u>    </u>	<u>JAN 05 2001</u>
	S <u>    </u> T <u>    </u> R <u>    </u>	<b>SECTION</b>

Register's Office }  
Gogebic County } ss.

Received for record the  
2<sup>ND</sup> day of OCTOBER  
A. D. 19<sup>TH</sup> 00 at 10:50 o'clock  
A m., and recorded in  
Liber 8 of CORNERS  
on page 70.  
Ramona Collins, Deputy  
Register of Deeds

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

$\frac{1}{4}$  Corner 22 & 27; T.48 N., R.48 W.

I, Richard L. Drahn, in a field survey on Sept 25, 2000 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

**NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.**

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

A. Description of original monument and accessories and/or subsequent restoration:

Original corner established by Austin Burt on 9/22/1848. Original bearing trees:

Cedar	12"	S.50° W.	35 links	(23.10')
Y. Birch	20"	N.60° E.	8 links	(5.28')

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I restored the corner position at record bearing and distance from the remains of the two original bearing trees. The first is a large diameter, shallow windthrown stump hole. The second one is now a very large series of root holes with fragments of Yellow Birch bark and fragments of unidentifiable hardwood. The 6.21 chain distance east to "stream 50 links, NW" checks to within 6 feet. A 19" Cedar "sign in tree" blazed facing the corner bears S.45° W., 15.6'. A location poster, dated 4/27/66, facing the corner, on a 9" Sugar bears N.74° W. 16.3' from the original corner position.


Corner research on file with Gogebic County records.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

At the corner position I set a 2" X 30" aluminum pipe with a 3 1/4" stamped aluminum cap and the following new blazed and scribed bearing trees: (measurements taken to a 10p nail in the side of the tree)

Sugar Maple	10'	N.53° W.	18.54'
Sugar Maple	11'	S.02° W.	13.86'
Basswood	14'	S.78° E.	32.02'
Steel sign rail	6'	N.27° E.	2.29'

Richard L. Drahn 9/27/00  
COUNTY REGISTERED SURVEYOR

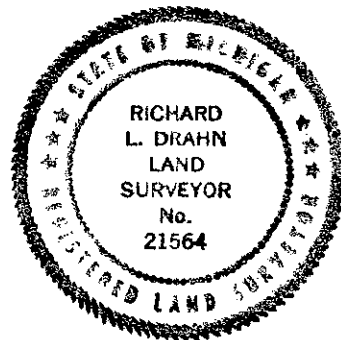

Signed by Richard L. Drahn Date September 27, 2000

Surveyor's Michigan License No. 21564

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971

REVISED MAY 14, 1976

REVISED JAN., 1983  
REVISED OCT., 1986