

SURVEY & REMONUMENTATION

SEP 08 1999

GRATIOT COUNTY REMONUMENTATION PROGRAM

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

LIBER 563 PAGE 1120

GRATIOT CO. MICH.
RECORDED

'96 DEC 26 AM 10 37

Janet M. Davis
REGISTER OF DEEDS

SECTION

For corners in

Gratiot

Located in:

Corner Code

#	(County)	Located In:	Corner Code
		<u>Lafayette</u>	
1.	Public Land Survey	Sec 31 T <u>11N</u> R <u>1W</u>	<u>B-13, S 1/4</u>
		T _____ R _____	_____
		T _____ R _____	_____
		T _____ R _____	_____
2.	Property Controlling in Section	S _____ T _____ R _____	_____
		S _____ T _____ R _____	_____
3.	Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
		S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

4. Lot No. _____ Recorded Plat _____
5. Private Claims _____

I, William Tingley a field survey on December 4, 1995, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6	5	4	3	2	1						
3													
4		7	8	9	10	11	12						
5													
6		16	17	16	15	14	13						
7													
8		19	20	21	22	23	24						
9													
10		30	29	28	27	26	25						
11													
12		31	32	33	34	35	36						
13													

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- 1831, Robert Clark, Jr., Deputy Surveyor, GLO Notes
- Set Quarter Section Post
- Hickory 9" N46-1/2°E 19 links
- White Ash 24" N83°W 9 links
- 1880, S.S. Hastings, County Surveyor, Field Book 11-1, Pages 78 and 79
- Oak Post 10 x 12 x 38 set deep and two stones by side
- No date, Field Book 10-1, Pages 24 and 25
- 1/4 Post 11-1 1.20 chains East of 1/4 Post, Section 6
- July 19, 1968 (noted in both field books above)
- Found old corner and set Monument Box
- No date, Gratiot County Road Commission records
- Monument Box 78.40 feet East of Monument Box (North 1/4 Section 6, Hamilton)


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
Found 1" pipe in Monument Box. 2.6 feet below found remains of woodstake. Raised with 3/4" pipe in Monument Box. 78.40 feet East of North 1/4 Section 6 (3/4" pipe in Monument Box).

ACCEPTED BY THE ~~MUSKOGEE~~ ^{GRATIOT} COUNTY SURVEY PEER GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD 12-7-96

WGT
William Tingley, PS, Chairman

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- Set Remonumentation Monument over 3/4" pipe
- Top Center Orange Carsonite witness post S45°E 45.95 feet
- Top Center Orange Carsonite witness post S45°W 44.25 feet
- Top Center Orange Carsonite witness post N45°E 44.75 feet
- Top Center Orange Carsonite witness post N45°W 48.80 feet
- 78.40 feet East of North 1/4 of Section 6 (3/4" pipe in Monument Box)

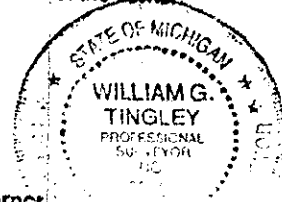

This corner is accepted as a careful and faithful perpetuation of the position of the original corner.

Signed by William Tingley Date 12 7 1996

Surveyor's Michigan License No. 30104

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JUNE 25, 1971
REVISED MAY 14, 1975
REVISED JAN, 1983
ADAPTED FOR WORD PROCESSING MARCH, 1983

97 File