

SURVEY & REMONUMENTATION

LIBER **562** PAGE **1305**

MAY 05 1997

GRATIOT COUNTY REMONUMENTATION PROGRAM
LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970

GRATIOT CO. MICH.
 RECORDED
 '96 NOV 26 PM 2 33

COMMISSION

Janet M. Davis
 REGISTER OF DEEDS

For corners in Gratiot Located In: Lafayette Corner Code # _____
 (County)

1. Public Land Survey Sec 32/ T 11N R 1W E-13, S. Bndry
 T _____ R _____
 T _____ R _____
 T _____ R _____

2. Property Controlling in Section S _____ T _____ R _____
 S _____ T _____ R _____

3. Miscellaneous Property in Sec. S _____ T _____ R _____
 S _____ T _____ R _____

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

Register of Deeds Stamp & File Number

I, William Tingley a field survey on December 5, 1995, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

- A. Description of original monument and accessories and/or subsequent restoration:
 1831, Robert Clark, Jr., Deputy Surveyor, GLO Notes
 Set Post Corner, Sections 32-33
 Elm 8" N58°E 23 links
 Black Ash 16" N78°W 9 links
 1882, T.H. Harrod, Deputy Surveyor, Field Book 11-1, Pages 82-83
 3" x 3" Post - Old Corner Found
 White Oak 18" N05°W 73-1/2 links
 1882, T.H. Harrod, Deputy Surveyor, Field Book 11-2, Pages 80-81
 Iron Bar 1-1/2" x 1/2", stones around
 Flat stone, 4 x 8 x 12 N27-1/4°E 60 links
 Liber B, Page 83, Record of Minutes of Survey at County Drain Commissioner's Office
 Has same 1882 record

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
 Found 3/4" x 10" Iron Pipe in Monument Box. At 1.4 feet deep found 1/2" x 2" x 1.5 foot bar in Grey Clay on Centerline of pavement. 46.95 feet East of Section Corner 4-5, T10N-R1W.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- Set Remonumentation Monument over 1/2" Bar
 North Corner Concrete Project Marker S20°W 73.24 feet
 Set Nail and Tag in 8" Wood Post (Cable Marker) S50°W 102.30 feet
 West End 15" CMP Culvert N35°W 39.37 feet
 Southwest Corner Southend of Curb on Westside of Ransom Road S45°W 88.73 feet


This corner is accepted as a careful and faithful perpetuation of the position of the original corner.

Signed by William Tingley Date 10/15/96
 Surveyor's Michigan License No. 30104

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
 REVISED MAY 14, 1975
 REVISED JAN., 1983
 ADAPTED FOR WORD PROCESSING MARCH, 1993

ACCEPTED BY THE GRATIOT COUNTY SURVEY PEER GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD 10/15/96

WGT
 William Tingley, P.S. Chairman

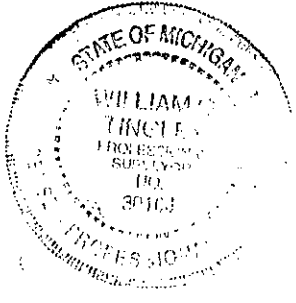

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													