

SURVEY & REMONUMENTATION

FEB 10 2000

SECTION

GRATIOT COUNTY REMONUMENTATION PROGRAM

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

LIBER 616 PAGE 913

STATE OF MICHIGAN
GRATIOT COUNTY
RECORDED

12 NOV 99 10:31 A.M.

JANET K. DAVIS
REGISTER OF DEEDS

For corners in

Gratiot (County)	Located In:	Corner Code #
	Bethany & Wheeler Township	
1. Public Land Survey	Sec T 12 N R 02 W T 12N R 01W T R T R	M-13 A-13
2. Property Controlling in Section	S T R S T R	
3. Miscellaneous Properly in Sec.	S T R S T R	

Register of Deeds Stamp & File Number

4. Lot No. _____ Recorded Plat _____
5. Private Claims _____

I, William G. Tingley a field survey on October 6, 1999, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
1886, S.S. Hastings, Record of Minutes of Survey, Liber C, Page 144


Large Sharp Stone
Popular 10" N62°E 80
Stone 8"x12" N42 1/2°E 68

April 9, 1993, William B. Ruddell, Recorded Survey, Liber 526, Page 1302

Se Corner Section 36
T12N-R02W, Bethany Twp.
Gratiot Co. MI (M-13)
Found Monument Box, Lid frozen, Used center
NE 40.3' Road Sign Post
WNW 40.7' North Leg On Stop Sign
SW 39.7' South Leg Stop Sign

September 23, 1993, Jan S. Fokens, Recorded Survey, Liber 530 Page 1353& 1354

SE Corner, Section 36, T12N-R02W
Bethany Twp. Gratiot Co. MI
Found Re-mon Box 6' North of Centerline
N50°W 39' Painted Top CI South end 24" CMP
N47°E 40.25' Sw'ly face Street Sign Post
S80°W 118.70'N& LSC tag Drop Pole
S35°E 44.82' Top Center Cable Box

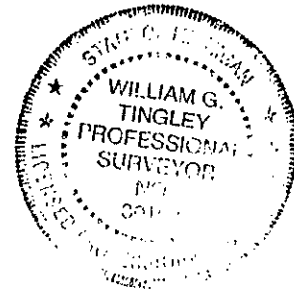

ACCEPTED BY THE GRATIOT COUNTY SURVEY PEER GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD 11/19/97

WGT
William Tingley, PS, Chairman

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found .5" iron rod 5' north of centerline with .5" iron rod and wood logs lying horizontally below
Top center cable box S45°E 50.20 Feet
Northwest end 48" Concrete Culvert N60°W 72.78 Feet
Northeast end 48" Concrete Culvert N60°E 72.18 Feet
Top Dead Center Catch Basin S40°W 51.35 Feet

Freshly repaved road and new culvert, possible new catch basin

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set Standard Remonumentation monument over .5" iron rod
Top center cable box S45°E 50.20 Feet
Northwest end 48" concrete culvert N60°W 72.78 Feet
Northeast end 48" concrete culvert N60°E 72.18 Feet
Top dead center catch basin S40°W 51.35 Feet

This corner is accepted as the best available evidence of the position of the original corner

Signed by William Tingley
Surveyor's Michigan License No. 30104

Date November 19, 1997