

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER	
1. PUBLIC LAND SURVEY	T. 25 N. R. 10 W.	K-12;	REGISTER OF DEEDS STAMP AND FILING NUMBER
2. PROPERTY CONTROLLING IN SECTION: 35	T. 25 N. R. 10 W.	14	
3. MISCELLANEOUS PROPERTY IN SECTION	T. N. R. W.		
4. LOT NO. ...., RECORDED PLAT			
5. PRIVATE CLAIMS			

I, CARL F. ROSER, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on SEPTEMBER 14, 1983, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner.

- 14 - FOUND SCHAAF PIPE MONUMENT IN APPROXIMATELY CTR. OF FIRE LANE'S N-S-E. DROVE 5/8" RE-ROD AND PUT SCHAAF MONUMENT ALONG SIDE (BURIED 0.4').
- K-12 - FOUND M. SCHAAF CONCRETE PIPE MONUMENT (BURIED) IN LINE WITH FIRE LANE TO EAST. CORNER FITS E.P. WATERMAN B.T. STUMP'S (W. PINE 20" N68°E 41 1/2' & W. PINE STUMP 18" REMAINS N78°W 41 1/2'); WATERMAN'S NOTES INDICATING HE HAD ONE U.S. B.T. STUMP, W. PINE 14" S51°W, 16 LINKS, THIS STUMP HAVING BEEN DOZED OUT 1940± AS A RESULT OF SCHAAF'S WORK. WATERMAN'S SURVEY WAS AT THE REQUEST OF THE TWP. HWY. COMM. 1907-1908.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

<u>14</u>	<u>K-12</u>
FD SQ. CONC MON W/ 1 1/4" PIPE;	FD SCHAAF MON(BURIED); REPLACED W/1"
REPLACED W/ 5/8"X 36" RE-ROD W/RLS CAP	X 36" PIPE W/RLS CAP
20" OAK N34°W 22.7'	12" RED PINE S50°E 25.4'
12" R. PINE N26°E 21.3'	8" OAK S80°E 47.7'
8" RED PINE S20°E 28.0'	4" MAPLE N35°E 35.3'
SET CED POST	SET CED POST
W/LOC TAG WEST 16.5'	W/LOC TAG WEST 16.5'

SIGNED BY Carl F. Roser 6/07/84 DATE \_\_\_\_\_

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

MICHIGAN REGISTERED LAND SURVEYOR

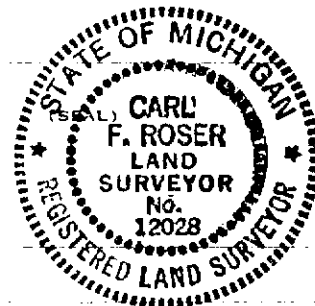

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_ GRAND TRAVERSE COUNTY