

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY_____	T. 25 <span style="float: right;">N. ●</span> , R. 11 <span style="float: right;">●</span> W.	I-10; J-9; K-9
2. PROPERTY CONTROLLING IN SECTION 26_____	T. 25 <span style="float: right;">N. ●</span> , R. 11 <span style="float: right;">●</span> W.	16
3. MISCELLANEOUS PROPERTY IN SECTION_____	T. _____, R. _____, S. _____, E. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, CARL F. ROSER do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram—over) were, in a field survey on MAY 22 1974, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_ 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

~~A. Description of original monument and accessories and/or subsequent restorations~~

C. (continued)

16

Set 1"x36" pipe  
 16" Maple S28°W 41.5  
 10" Maple S44°E 44.3  
 10" Twn. Maple N47°E 27.2  
 center E-W dirt trail Due N 7'  
 set ced. post w/loc. tag  
 Due S 33'

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- I-10 Restored corner on straight line between section corners N & S and on E-W fence line. Fits survey of E-W ¼ line of Section 26, E. P. Waterman, Liber 5, page 221, 1903 & 1907.
- J-9 Found 1" rod in center of E-W county road in line with fence to N & S. Fits survey of Section 26, Liber 5, page 221, 1903±.
- K-9 Found 3/4" pipe. Fits survey of Section 26, Liber 5, page 221, 1903±.
- 16 Established corner per standard B.L.M. instructions, which fits average line of fence remains north.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I-10	J-9	K-9
Set DNR mon. w/ced. post	Found 1" Rod	Drove 1"x18" pipe over fd. 3/4" pipe
14" Maple N15°E 36.0	30" Maple S65°E 88.80	26" Maple Due N 79.10
12" Cherry S40°E 20.8	14" Maple N03°W 134.40	20" Elm S06°W 77.80
8" Maple S31°W 18.5	in line With Fn. N & Fn. S	center E-W county road Due N 4'
48" W. Pine stump N62°W 26.8	on center E-W county road	


SIGNED BY Carl F. Roser DATE 7-3-74

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ CHIEF OF SURVEY PARTY DATE \_\_\_\_\_

APPROVED AND SIGNED BY \_\_\_\_\_ MICHIGAN REGISTERED LAND SURVEYOR DATE \_\_\_\_\_

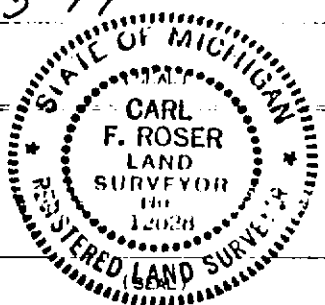

**MAYFIELD TWP.**  
GRAND TRAVERSE COUNTY