

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____ T. 25 N. R. 11 W.	●	C-11; G-7; G-8
2. PROPERTY CONTROLLING IN SECTION 27, T. 25 N. R. 11 W.	●	1
3. MISCELLANEOUS PROPERTY IN SECTION _____, T. _____ N. S., R. _____ E. W.		
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on May 20, 1974, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

~~A. Description of original monument and accessories and/or subsequent restorations~~

C. (continued)

1
Set 1"x36" pipe (buried 0.5')
6" Maple S35°W 29.0
4" Maple S59°E 25.5
9" Cherry N08°W 24.3
Set ced. post w/loc. tag
Due S 30'

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- C-11 Restored corner in Fall of 1973 from one remaining witness and fence East (called for old survey) per E. P. Waterman survey, L. 6, page 58, 1917, and L. 10, page 104, 1911.
- G-7 Recovered corner per E. P. Waterman survey of Sec. 22, Liber 2, page 324, 1908 & 1909.
- G-8 Recovered stone per E. P. Waterman survey of Sec. 22, Liber 2, page 324, 1908 & 1909.
- 1 Established corner per standard B.L.M. instructions. Pipe falls in southerly wheel track of E-W trail road.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

C-11	G-7	G-8
Drove 3/4"x8" square boat spike	Found monument box w/3/8" spk.	Set DNR mon. (fd. stone)
24" Maple N83°W 151.65	22" Maple S25°E 64.79	set ced. post Due W 33'
30" Maple N75°W 127.07	32" Maple N77°E 85.47	mon. in center N-S gravel rd.
30" Maple N40°E 73.80	SE corner of Town Hall Bldg.	Fn. corner post Due E 24.6
Set ced. post w/loc. tag	N35°W 54.5	Fn. corner post Due W 26.1
Due E 33'	Set ced. post w/loc. tag	
Center N-S b'top road (M-37)	S45°E 55'	
Due W 4'		


SIGNED BY Carl F. Roser DATE 7-4-74

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ CHIEF OF SURVEY PARTY DATE _____

APPROVED AND SIGNED BY _____ MICHIGAN REGISTERED LAND SURVEYOR DATE _____

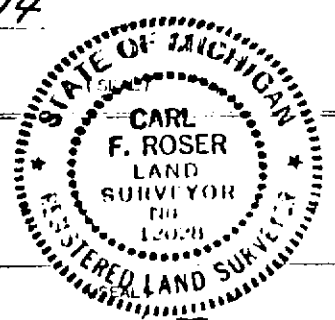

MAYFIELD TWP.
GRAND TRAVERSE COUNTY