

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF --:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY.....	T. 25 N. R. 12 W. ●	A-6; B-7
2. PROPERTY CONTROLLING IN SECTION 18.....	T. 25 N. R. 12 W. ●	15
3. MISCELLANEOUS PROPERTY IN SECTION.....	T. N. R. E. S. R. W.	
4. LOT NO. _____, RECORDED PLAT.....		
5. PRIVATE CLAIMS.....		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on July 18, 1979, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- A-6** Reestablished 1/4 corner equidistant & on line between sec. corners to N & S. Fits Allyn 1904 sur. of Sec. 18, L. 3, p. 308 of Co. Sur. Rec. at Reg. of Deeds. Q of dirt rd. S is E 2'±; Q of dirt rd. E is N 2'±; Q of trail rd. W is N 4'±.
- B-7** Fd. Dept. mon. for S 1/4 corner Sec. 18 as set by RLS K. J. Ostling (Dept. survey 1966) from fd. USBT stump NW.
- 15** Fd. rotted pine post bottom from two E. H. Allyn wits; 28" W. Pine stump S68°W 23.1' and 24" W. Pine stump N10°E, 21.1'. See Allyn's 1904 survey of Sec. 18, old Co. Sur. Rec. at Reg. of Deeds, L. 3, pp. 308 & 309. Also fd. rotted pine stk. bottom, P.O.B.\* of Waterman rd. sur. L. 2, p. 554, dated July 1909. Drove 1/2"x32" pipe at this point, which fell on S. line of Sec. 18. See wit (item "C") for tie to 1/8 corner

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

A-6	B-7	15
Set 5/8"x3' rerod w/RLS cap buried 0.5	Found DNR Monument	Drove 5/8"x40" rerod w/RLS Cap at fd. pine post bottom
4" Oak N05°W 102.8	17" Oak S18°E 5.73	8" W. Oak S64°W 50.2
6" Cherry N88°W 81.2	16" Oak N45°E 29.09	10" Twn. Maple S47°E 47.0
11" Maple S26°E 86.7	6" Maple N30°W 25.09	P. Pole N22°W 85.35
Set cedar post North 33'		*Drove 1/2"x32" pipe at fd. E.P.W. stake bottom N89°38'W 82.82


SIGNED BY Carl F. Roser 4-8-80 DATE

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
MICHIGAN REGISTERED LAND SURVEYOR

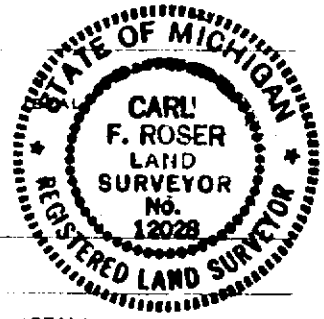

GRAND TRAVERSE COUNTY  
GRANT TOWNSHIP

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_