

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

FOR CORNERS OF --:	LOCATED IN --:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY.....	T. 25 N. R. 12 W.	G-6; I-5; I-6
2. PROPERTY CONTROLLING IN SECTION 16	T. 25 N. R. 12 W.	7
3. MISCELLANEOUS PROPERTY IN SECTION.....	T. S. R. W.	
4. LOT NO., RECORDED PLAT.....		
5. PRIVATE CLAIMS.....		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on August 14, 1979, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. - Description of original monument and accessories and for subsequent restoration:

C. (continued)

7		
Fd. 2" pipe & set cedar post w/loc. tag.		
8" Maple Clmp.	N49°W	21.3
7" Maple	S49°E	15.5
20" Oak	N30°E	44.5

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- G-6** Fd. RR spike for E 1/4 cor. Sec. 16 that fits fd. 1/8 cor. & fd. sec. cor. to S doubled over & also fits fd. 1/8 cor. & fd. sec. cor. to N per E.H. Allyn survey of Sec. 15 (1903) & E.P. Waterman 1912, L. 2, p. 90 & L. 3, p. 204 of old Co. Sur. Rec. at Reg. Deeds. Cor. is in Q ± b' top rd. to S, Rd. curves NE'ly from corner.
- I-5** Fd. 5/8" rerod as set by RLS John Nelson over fd. 3/4" iron; said iron having been recovered by Perla from previous surveys.
- I-6** Fd. 1"x5" rod over large rock for E 1/4 cor. Sec. 15. Cor. is in line with fns. to E & W. Corner falls in ctr. of N-S gravel road.
- 7** Fd. 2" pipe for 1/8 cor. that fits Allyn 1903 survey distances reasonable. See L. 2, p. 90 of old Co. Sur. Rec.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

G-6	I-5	I-6
Fd. RR spike w/+ on top; repl. w/1 1/2"x18" solid iron rod w/+ on top.	Fd. 5/8" rerod w/RLS cap (buried).	Fd. 1"x5" rod buried 0.2, resting on large rock.
7" Maple N49°E 46.76	5" Maple N11°W 29.25	21" Maple N26°W 52.29
8" Maple N45°W 43.12	7" Twn. Maple S75°E 21.23	21" Maple N66°W 42.20
P. Pole S36°W 62.13	8" Maple S30°W 47.62	28" Maple S20°E 63.61
Set ced. post w/loc. tag		
Due W 33'		

SIGNED BY Carl F. Roser 4-8-80 DATE

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____

MICHIGAN REGISTERED LAND SURVEYOR

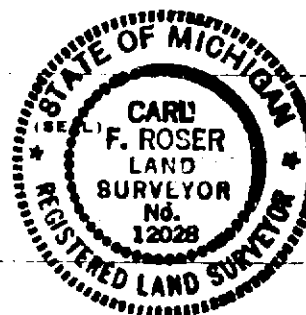

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

GRAND TRAVERSE COUNTY
GRANT TOWNSHIP