

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF --:	LOCATED IN --:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 25 N. R. 12 W.	E-3
2. PROPERTY CONTROLLING IN SECTION 8	T. 25 N. R. 12 W.	12; 13; 14
3. MISCELLANEOUS PROPERTY IN SECTION	T. N. S. R. E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER _____

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on August 29, 1979, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____ found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A - Description of original monument and accessories and/or subsequent restoration:

C. (continued)

14
Fd. 3/8"x24" pipe; replaced w/5/8"x36" rered w/RLS cap & set cedar post w/loc. tag.
12" Oak S31°E 25.9
16" Oak S32°W 11.5
6" Maple N49°W 25.4

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- E-3** Fd. round conc. mon. w/rered for NW corner Sec. 9; fits Gourdie-Fraser witnesses. Fits E. P. Waterman survey of NE 1/4 of Sec. 8, L.2, Pg.378, 1909.
- 12** Reestablished SW corner of "Plat of Karlin" Point B, which is S 1/8 corner on N-S 1/4 line Sec. 8, by pushing st. line across two fd. plat irons to E & record dist. of 375' W of W'ly fd. iron. This fits other fd. plat irons very reasonably.
- 13** Fd. 3/4" pipe for ctr. of SE 1/4 of Sec. 8. This is Point C per "Plat of Karlin". This pipe fits other plat irons to west and one plat wit. stump.
- 14** Fd. 1/8 corner as established to R.L.S. P. Perla in 1969 survey for NE 1/4-SE 1/4 Sec. 8.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

E-3	12	13
Fd. round conc. mon. & added cedar post w/loc. tag.	Drove 5/8"x3' rered w/RLS cap & set ced. post w/loc. tag.	Fd. 3/4" pipe & set cedar post w/loc. tag.
25" Oak N84°E 83.24	11" Oak N24°W 32.08	6" Maple S27°W 65.75
6" R. Pine S50°E 75.40	10" Oak N66°E 45.33	5" Maple S25°E 43.89
21" Oak S18°E 49.62	6" Maple S55°W 47.90	16" Oak N29°W 80.54
*Old witness		Ctr. of power line running NE-SW Due N 21±

SIGNED BY Carl F. Roser 4-8-80 DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____

MICHIGAN REGISTERED LAND SURVEYOR

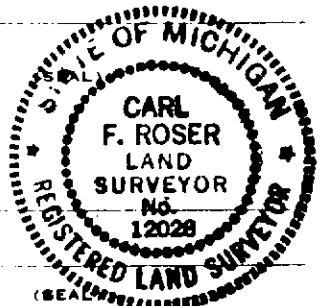

SURVEYOR'S MICHIGAN REGISTRATION NO. _____ GRAND TRAVERSE COUNTY
GRANT TOWNSHIP