

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 25 N. R. 12 W.	A-2; D-5
2. PROPERTY CONTROLLING IN SECTION 6	T. 25 N. R. 12 W.	5
3. MISCELLANEOUS PROPERTY IN SECTION	T. N. R. E. S. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on July 23, 1979, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- A-2** Fd. & accepted conc. mon. for W $\frac{1}{4}$ corner Sec. 6 as set by Perla & Stout in 1965 survey of Sec. 6; they set corner pro-rated to U.S.
- D-5** Restored $\frac{1}{4}$ corner from C. P. Tuller's wits: w. pine stump SW showing face w/scribe marks & w.p. stump NE, partially decayed, faced side on ground. C.P. Tuller's notes obtained from his grandson T.C. Tuller at Kalkaska; field book #39, pp. 30-33, dated 1916. Corner fits N-S $\frac{1}{4}$ line Sec. 8, Karlin Plat very close. Also see Gr. Trv. Co. Sur. Rec. at Reg. of Deeds, L. 1, p. 154, H.F. Northrup 1898 who had same position as Tuller from USBT Hemlock SE.
- 5** Established N 1/8 corner on N-S $\frac{1}{4}$ line Sec. 6, pro-rated to GLO between center & N $\frac{1}{4}$ of S-6.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

A-2	5	D-5
Fd. conc. mon.; added cedar post w/loc. tag	Drove 5/8"x3' rerod w/RLS cap & set cedar post w/loc. tag	Set DNR Monument & Cedar Post
7" W. Pine N66 ⁰ W 31.2	10" Maple S20 ⁰ W 12.7	11" Maple S15 ⁰ E 26.0
6" Twn. Cherry S17 ⁰ E 10.9	16" Maple N60 ⁰ W 29.7	7" Maple N70 ⁰ W 12.2
12" Maple S66 ⁰ E 50.6	7" Hemlock N35 ⁰ E 22.0	17" Oak N50 ⁰ E 38.6
4" W. Pine N84 ⁰ E 24.6		C.P.T. 20" W.P. stp. S79 ⁰ W 17.5
		C.P.T. 24" W.P. stp. N42 ⁰ E 43.5±


SIGNED BY Carl F. Roser 4-8-80 DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

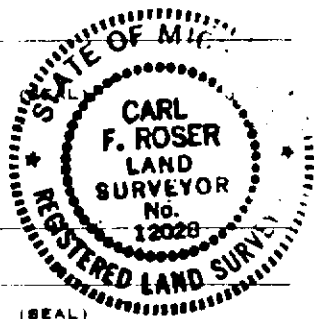

SURVEYOR'S MICHIGAN REGISTRATION NO. _____ GRAND TRAVERSE COUNTY
 GRANT TOWNSHIP