

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>26</u> <sup>N.</sup> <u>●</u> , R. <u>12</u> <sup>W.</sup> <u>●</u>	G-3; G-4; H-3; H-5
2. PROPERTY CONTROLLING IN SECTION _____	, T. _____, S., R. _____	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____, S., R. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER \_\_\_\_\_

I, Carl F. Roser do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on January 15, 1975, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_ 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

**A. Description of original monument and accessories and/or subsequent restoration:**

C. (continued)

H-5

Set PK in Bit. Capped Conc. Pvt.	
Ctr. US-31	Due N 0.3
Set 1 1/2" x 72" pipe & Post	N01°17'E 75.30
20" W. Pine	N42°W 104.2
18" W. Pine	N16°E 90.5
12" W. Pine	S30°W 100.0

**B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:**

- G-3 Reestablished corner by double proportion to original U.S. survey of 1839.
  - G-4 Recovered concrete monument by R.L.S. Fraser.
  - H-3 Restored corner from probable U.S.B.T. (stump) pine NE, which fits George Steele split-up of Sec. 10 in 1887.
  - H-5 Restored 1/4 corner common to Sec. 10 & 15, per old surveys of record by Geo. Steele (1887), C.P. Tuller (1894-1914) and E.P. Waterman (1908). This would be on straight line between sec. corners to E & W and at average of above listed surveys for their distances ~~of~~ record on S line of SE 1/4 of Sec. 10; which fits line of occupation N from E 1/16 on S line of Sec. 10.
- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

G-3	G-4	H-3
Set DNR mon. & cedar post	Found 4" Conc. Mon.; set	DNR Mon. & cedar guard post
4" R. Pine N07°E 29.2	cedar post w/loc. tag	5" Maple N27°W 51.1
6" R. Pine S75°E 38.2	22" oak N47°W 6.90	5" Oak S69°E 48.4
6" W. Pine S57°W 55.0	12" Oak N81°W 25.65	10" Oak S28°E 16.6
N-S fence Due W 13	20" W. Pine S79°W 40.20	8" Oak S33°W 59.8
Ctr. NW-SE dirt rd.	Ctr. N-S dirt road	E-W Random Due N 37.7
Due E 62	Due E 16	
N-S Rand. Due E 2.4	Fence corner Fence N & W	
	N50°W 6.5	


SIGNED BY Carl F. Roser 9-3-75 DATE \_\_\_\_\_

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
MICHIGAN REGISTERED LAND SURVEYOR

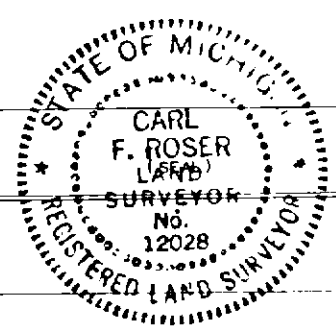

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_ GREEN LAKE TOWNSHIP  
 GRAND TRAVERSE COUNTY