

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. 26 ^{N.} _{S.} R. 12 ^{W.} _{E.}	F-3; G-2; G-5; I-1; I-2
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ S., R. _____ E. W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ S., R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on April 24, 1975, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____ found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monuments and accessories and/or subsequent restoration:

C. (continued)

I-1	I-2
Found 2" pipe & set cedar post w/loc. tag	Set DNR monument w/cedar post
10" Maple N47°W 14.08	17" R. Pine S50°W 59.2
5" Cedar S25°E 3.95	10" Oak S56°E 17.8
8" Tamarack S87°E 30.26	4" Maple N51°E 37.6
10" Cedar N57°E 12.94	

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- F-3 Recovered 3/4" pipe in center of N-S b'top county road. Corner by R.L.S. Fraser.
- G-2 Recovered concrete monument by R.L.S. Perla.
- G-5 Recovered corner of record by R.L.S. Walt Fraser.
- I-1 Found 2" pipe by R.L.S. Fraser. Old corner of record. The SW corner of Sec. 35, T. 27 N., R. 12 W., is 55.44 feet east.
- I-2 Restored corner in old N-S fence remains by large cedar post and picket; which fits surveys by Tuller and Norton.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

F-3	G-2	G-5
Found 3/4" pipe	Found 4" Conc. Monument, set post w/loc. tag	Found 3/4" pipe in Bit. capped concrete pavement
9" R. Pine N38°W 101.0	20" Oak S24°W 32.5	22" Oak N50°E 89.33
14" Oak S43°W 81.3	20" Oak N60°E 52.8	14" R. Pine S47°W 124.76
12" Maple N52°E 99.1	12" Oak N32°W 69.2	Power Pole N17°W 77.77
Set cedar post w/loc. tag	Center N-S dirt Road	16" R. Pine S44°E 71.55
Due E 33	Due E 12	Center US-31 Due N 2.45


SIGNED BY Carl F. Roser 9-3-75 DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY _____ DATE _____

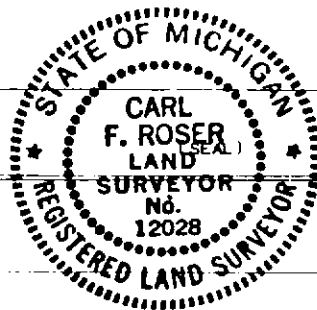

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

GREEN LAKE TOWNSHIP
GRAND TRAVERSE COUNTY