


# LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. PA 1970


For Corners In: Grand Traverse (County)	Located In	Corner Code #
1. Public Land Survey	T _____ R _____	_____
2. Property Controlling in Section	T _____ R _____	_____
	S 11 T 27N R 9W	CNSW 1/64
	S 10&11 T 27N R 9W	NS 1/64
3. Miscellaneous Property in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No: _____	Recorded Plat: _____	
5. Private Claims: _____		

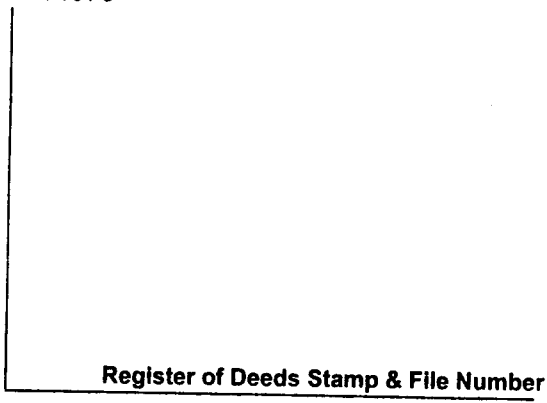

**Register of Deeds Stamp & File Number**

I, Craig W. McVean, in a field survey on May 30, 2000 do hereby state that under requirements of PA 74, Michigan PA of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

**NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.**

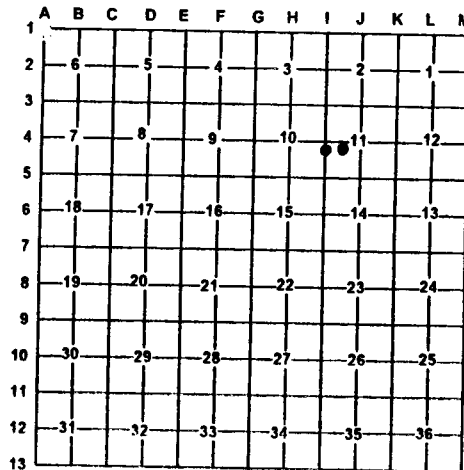

**A. Description of original monument and accessories and/or subsequent restoration:**

CNSW 1/64 - None

NS 1/64 - L.2 P.292 - E.P Waterman 1907 - cedar stake in highway

**B. Description of corner evidence found and/or method applies in restoring or re-establishing corner:**

CNSW 1/64 - Sec. 10 and being the SE. Cor. of N 1/2 of NW 1/4 of SW 1/4 of Sec. 11, T27N, R9W  
Set stamped 2" Alum. Cap on 5/8" x 34" Rebar per Standard BLM Procedure. Corner of old down fence remains W&S is 5' N & 12'+/- E

NS 1/64 - Common to sec. 10 & 11 and being the SW Cor. of N 1/2 of N 1/2 of SW 1/4 Sec. 11 T27N, R9W  
Set 2" Alum. Cap on 5/8" x 34" Rebar - down 0.3' - per Standard BLM Procedure. - Fits Waterman's Distances. Trace of old fence E is 4' +/- N.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

CNSW 1/64 - 2" AC on 5/8" x 34" Rebar  
N32°E 61.66' to set N&T in NE side 31" R. Oak  
N87°E 37.65' to set N&T in S. side 11" S. Maple  
S16°E 12.53' to set N&T in E. side 4" R. Oak  
N38°W 36.54' to set N&T in SW side 13" R. Pine  
Set Blue Carsonite Post w/ loc. tag 1' NE

NS 1/64 - 2" Alum. Cap on 5/8" x 34" Rebar  
N75°E 97.99' to set N&T in S. side 14" R. Pine  
N35°E 103.61' to set N&T in NW side 12" R. Pine  
S53°W 114.46' to set N&T in SE side 15" Cherry  
East 33.00' to set 2" AC on 5/8" x 34" Rebar with Blue Carsonite Post w/ loc. tag on line.

Signed by:

*Craig W. McVean*

Date:

1/22/2001

Surveyor's Michigan License No.:

39088

