

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>27</u> ^{N.} <input checked="" type="radio"/> , R. <u>10</u> ^{W.} <input checked="" type="radio"/>	K-4; K-5; K-6
2. PROPERTY CONTROLLING IN SECTION _____	T. _____, ^{N.} <input type="radio"/> , ^{S.} <input type="radio"/> , R. _____, ^{E.} <input type="radio"/> , ^{W.} <input type="radio"/>	_____
3. MISCELLANEOUS PROPERTY IN SECTION <u>23</u>	T. <u>27</u> ^{N.} <input checked="" type="radio"/> , R. <u>10</u> ^{W.} <input checked="" type="radio"/>	XX (328.11 E of J-7 & 2,296.79 W of K-7)
4. LOT NO. _____	RECORDED PLAT _____	
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on March 31, 1976, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on March 31, 1976, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

~~A. Description of original monument and subsequent restoration:~~

C. (CONTINUED)

XX

Set 1"x36" pipe & cedar post w/loc. tag

14" Oak	N51°E	22.6
8" Maple	S30°E	21.3
5" Maple	S67°W	33.9
6" Maple	N13°W	32.0

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- K-4 Recovered DNR monument from 1966 Department survey said monument being a restoration of 1852 govt. corner per U.S.B.T. remains, W. Pine stump w/good lower face, N69°W 12.5.
- K-5 Found dept. monument as a restoration of govt. corner from probable U.S.B.T. stumps in 1966.
- K-6 Restored ¼ corner at old corner fence post (down) fence remains S & W. Corner fits C.P.Tuller witness, R. Pine S87°E and U.S.B.T. 24" Y. Pine stump, S07°E.
- XX Established the NW corner of the E½ W½ NW¼ NE¼ of Sec. 23 per standard B.L.M. instructions.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K-4	K-5	K-6
Fd. DNR mon. & cedar post	Fd. DNR mon. & cedar post	Set DNR mon. w/cedar post by old corner fence post
9" R. Pine S19°E 27.8	10" R. Pine N59°E 35.6	20" R. Pine S87°E 24 (CPT)
8" R. Pine S47°W 34.6	12" R. Pine S18°E 27.2	Y.Pine (stp.24") S07°E 27.1 (US)
8" Oak N54°W 20.0	16" W. Pine S57°W 33.7	7" B. Oak S12°W 48.6
6" R. Pine N33°E 9.7	6" W. Pine N50°W 10.4	9" W. Oak N35°W 8.7


SIGNED BY Carl F. Roser 4-28-77 DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

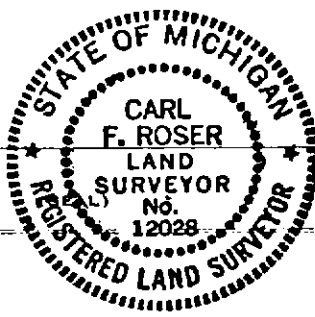

SURVEYOR'S MICHIGAN REGISTRATION NO. _____ GRAND TRAVERSE COUNTY

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET