

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. 27 N. R. 10 W.	I-5; I-6; L-6
2. PROPERTY CONTROLLING IN SECTION 14	T. 27 N. R. 10 W.	16
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ S. R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on November 10, 1975, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

~~A. Description of original monument and accessories and of subsequent restoration:~~

C. (CONTINUED)

16
Set 1"x30" pipe & cedar
post w/loc. tag
6" W. Pine N64°E 22.1
7" Maple S44°E 11.8
4" W. Pine N65°W 29.0
6" W. Pine N20°W 37.5

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- I-5 Restored NW corner Sec. 14 at double distance & on line across the fd. N¼ & W 1/16 on N line Sec. 14 per survey by E.P.Waterman dated 1907. Corner restored by this method would seem to best fit previous surveys in Sec. 11, 14 & 15 by Waterman, Fraser & Perla.
- I-6 Recovered 1½" pipe (buried) in road that fits large double elm stump SE per survey of Sec. 14 by Waterman dated 1907.
- L-6 Recovered shadow of stk. bottom from old C.P.Tuller wit. per Tuller Sec. 13 Sec. sub'n. for center of Sec. 13. Waterman notes dated 1917 say he accepted Tuller center of section as set at intersection of ¼ lines.
- 16 Established 1/16 corner per standard B.L.M. instructions.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

<p style="text-align: center;">I-5</p> <p>Set DNR mon. & cedar post</p> <p>6" Oak N25°W 13.6</p> <p>5" Oak N83°W 18.1</p> <p>7" Oak S32°W 34.7</p> <p>12" Oak S07°E 31.9</p> <p>Fd. 1" iron bar S06°W 12.70</p>	<p style="text-align: center;">I-6</p> <p>Fd. 1½" pipe (buried 0.8') at N'ly edge of E-W gravel rd.</p> <p>Powerpole N05°E 26.79</p> <p>9" W. Pine S41°E 126.43</p> <p>36" Db1.Elm Stp. S11°E 60.38</p> <p>Cor.Fn.Post w/loc. tag N03°E 32.5</p> <p>Fd. ½" pipe N 33</p> <p>Fd. bent ½" pipe in rd. S 33</p>	<p>Set 1½"x36" pipe-cedar post w/loc. tag</p> <p>10" Oak S26°E 26.4</p> <p>12" W. Pine N43°E 36.5</p> <p>10" R. Pine N32°W 80.0</p> <p>12" Oak N69°W 77.2</p> <p>Old W.Pine Stp. witness N08°E 5.3</p>
---	--	--

SIGNED BY Carl F. Roser 4-28-77 DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____

MICHIGAN REGISTERED LAND SURVEYOR

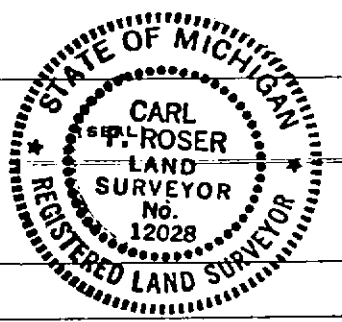

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____ GRAND TRAVERSE COUNTY

FORM APPROVED BY MICHIGAN STATE BOARD OF REGISTRATION, JAN. 28, 1971
REVISED MAY 14, 1975

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET