

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 27 N. R. 10 W.	L-7
2. PROPERTY CONTROLLING IN SECTION 13	T. 27 N. R. 10 W.	12; 15
3. MISCELLANEOUS PROPERTY IN SECTION	T. N. S. R. E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on October 15, 1975, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
 Restored $S\frac{1}{4}$ Sec. 13 on line between fd. SW & SE of Sec. 13 & at prorated distant to C.P. Tuller survey of Sec. 13 dated 1889. This fits almost exactly for st. line between found $N\frac{1}{4}$ & ctr. of Sec. 13. NOTE: The $1\frac{1}{4}$ " pipe approx. 34' W of our $\frac{1}{4}$ corner was erroneously estab. by RLS Pete Perla in 1967 in survey of N line Sec. 24 at proportionate dist. between the same NE Sec. 24 as accepted by this survey but using an old R-O-W fence corner for NW Sec. 24. We fd. the proper NW Sec. 24. Perla's survey was for Consumers Power Co., Job No. 8240, Drawing No. SF-16878, Sheet No. 10.

Established 1/16 corner per standard B.L.M. instructions.
 Established 1/16 corner per standard B.L.M. instructions.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

L-7	12	15
Set DNR mon. & cedar post	Set 1"x36" pipe & cedar	Set $1\frac{1}{4}$ "x36" pipe & cedar post
10" Oak N51°W 20.8	post w/loc. tag	w/loc. tag
4" P.Stp. N41°E 35.8	7" W. Pine N25°W 23.9	8" Oak N66°W 20.1
5" Maple S43°E 30.2	8" Oak S15°W 11.4	9" R. Pine N82°E 37.3
4" Maple S34°W 30.3	8" Oak S46°E 31.1	6" Oak S21°E 11.0
fd. $1\frac{1}{4}$ " pipe S85°30'W 34.92		4" W. Pine S45°W 52.7

SIGNED BY Carl F. Roser 4-28-77 DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____

MICHIGAN REGISTERED LAND SURVEYOR

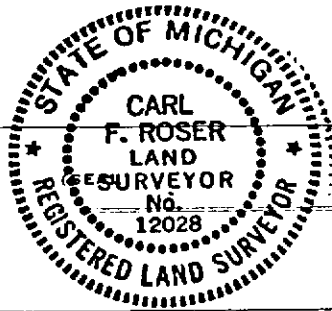

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

GRAND TRAVERSE COUNTY

FORM APPROVED BY MICHIGAN STATE BOARD OF REGISTRATION, JAN. 28, 1971
 REVISED MAY 14, 1975

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET