

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF --:	LOCATED IN --:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. 27 ^{N.} <input checked="" type="radio"/> , R. 10 ^{W.} <input checked="" type="radio"/>	K-7
2. PROPERTY CONTROLLING IN SECTION 13 _____	T. 27 ^{N.} <input checked="" type="radio"/> , R. 10 ^{W.} <input checked="" type="radio"/>	8; 9
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ ^{N.} _____, R. _____ ^{E.} _____ ^{W.} _____	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl R. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on October 20, 1975, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

K-7 Recovered bottom 10"± of old ptd. pine stk. bottom which fits E.P. Waterman survey of Sec. 14 (dated 1907) & C.P. Tuller survey of Sec. 13 (dated 1889). Fd. pine stk. bottom in line w/old twp. rd. grade to N (rd. in curve SE'ly 25'± E at corner). Conc. Mon. 33'± W'ly was set by RLS Pete Perla at end old fn. post, fence remains N, which is actually an old R-O-W fence. Perla survey was in 1967 for Consumers Power Co., Job No. WO-8240, Drawing No. S-F 16878, sheets 9 & 10. Also see corner records S¼ Sec. 13, Code L-7.

8 Established 1/16 corner per standard B.L.M. instructions.

9 Recovered & accepted E 1/16 on E-W ¼ line as estab. by Tuller in 1889. Fd. stk. bottom shadow from stump remains of Tuller witnesses, W.P. NW & Y.P. NE.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K-7	8	9
DNR Monument & cedar post	Set 1½"x36" pipe & cedar post w/loc. tag	Set 1"x36" pipe & cedar post w/loc. tag
6" Maple S36°W 41.0	8" W. Pine N13°W 38.0	14" W. Pine N26°W 31.7
7" Maple S16°E 22.8	7" R. Pine S75°E 12.9	6" Oak N35°E 29.8
6" R. Pine N62°E 94.4	12" R. Pine S28°W 30.8	8" R. Pine S71°E 34.8
Fd. round conc. mon. S81°00'W 32.66	E-W Random Due N 3'	E-W Random Due N 7.5

SIGNED BY Carl F. Roser 4-28-77 DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____

MICHIGAN REGISTERED LAND SURVEYOR

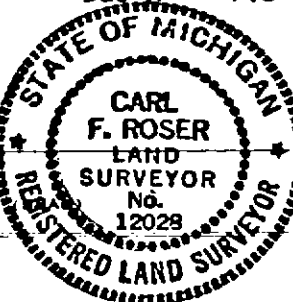

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____ GRAND TRAVERSE COUNTY