

APPROVED LAND CORNER
P.A. 345 OF 1990
Houghton County

331

MAY 16 1997

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

COMMISSION

For corners in

Houghton
(County)

Located In:

Corner Code #

- 1. Public Land Survey T 47N. R 37 W. E-8
T ___ R ___
T ___ R ___
T ___ R ___
- 2. Property Controlling S ___ T ___ R ___
in Section S ___ T ___ R ___
- 3. Miscellaneous S ___ T ___ R ___
Property in Sec. S ___ T ___ R ___
- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

REGISTER'S OFFICE

Houghton County, Mich.

Received for record the... day
of... A. D., 1996 at...
o'clock... M. and recorded in Vol. ...
of... Page...
Register

Register of Deeds Stamp & File Number

Quarter corner 20 & 21; T.47 N., R.37 W.

I, Richard L. Drahn a field surveyor on May 17, 19 95
do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned
in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the
current manual of survey instructions of the United States Department of the Interior, Bureau of Land
Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5
above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a
Court of Law; established, re-established, monumented, re-monumented, recovered, found as
expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

NOTE: Not more than 4 corners, all in the same town and range, may be recorded
on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

Original corner established by E.C. Martin, Deputy Surveyor on August 22,
1851. Original bearing trees:

Cedar	16"	S.26 E.	(no distance provided in notes)
Hemlock	20"	N.50 W.	(no distance provided in notes)

Corner research record on file with Houghton County. (4/18/95)


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

After re-establishing the quarter corner by single proportionate methods,
I recovered a 24-30" Hemlock stump decayed to ground line bearing N.50 W.,
33.3 feet. This Hemlock is believed to be the original B.T. No evidence
remains of the Cedar B.T. A 1935 era F.S. Location Poster bears N.46 W.,
42.6 feet and a downed 2" x 5' Cedar picket bears N.46 W. 37.5 feet. Both
the old location poster and the newer picket are in close proximity to the
remains of the Hemlock stump believed to be the original B.T.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

At the corner position I set a 2 1/2" x 30" long aluminum monument with a 3 1/2"
aluminum cap, stamped to read: T.47 N., R.37 W.; 1/4; S-20, S-21: 1995;
R.L.S. 21564. From which I established the following new blazed and scribed
bearing trees:

10"	Sugar Maple	N.02 W.	20.56 feet
10"	Ash	S.69 E.	21.96 feet
17"	Hemlock	S.32 W.	16.86 feet
6'	Steel rail	S.10 W.	1.10 feet

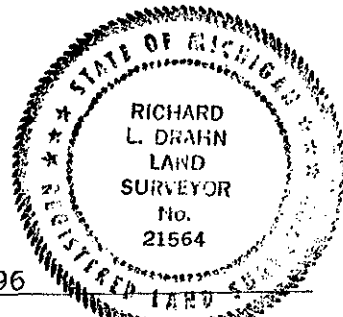

Signed by Richard L. Drahn

Date February 26, 1996

Surveyor's Michigan License No. 21564